

**Invoice No.**  
000035331

Page 1  
Order Date 04/09/22 11:31 am  
Completed: 04/22/22 05:32 pm

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

89 Saab 900 Conv` t red  
43801 Mi.Last in 6/11/2021  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Eq:

**Job01 Spring inspection** Labor: \$135.00

{1} Service call to pick up car due to flat LF tire during storage. {2} Mechanical inspection found: [a] LF tire and wheel damaged from pothole [b] Outer CV boots torn and leaking grease [c] Antenna mast slightly bent affecting full retraction [d] Various minor seepage leaks of oil and coolant [e] Minor wear to tie rod ends. No repair needed. [f] Rear seat cushion leather is torn. Will look for good used seat. Otherwise would need to make new cover. [g] No other issues noted. Runs and drives well.

Job Subtotal: \$135.00

**Job02 Replace CV boots** Labor: \$540.00

Replace torn outer CV boots and repack all 4 CV joints

89 93 628	outer CV boot-S	2.0 @	37.88 =\$	75.76	
13329237	CV grease packets-S	2.0 @	13.97 =\$	27.94	103.70
				Job Subtotal: \$643.70	

**Job03 Wheels and tires** Labor: \$120.00

LF tire damaged from pothole. Other tires old/marginal. Replace 4 tires with "closeout" Bridgestone Ecopia tires dated 2019 [current replacement cost approx. \$145 each]. Mount and balace 4 tires. Disposal of old tires. Replace LF wheel that was slightly bent from pothole incident.

NPN-USED	LF wheel-S	1.0 @	150.00 =\$	150.00	
185/65R15	Bridgestone tires-S	4.0 @	89.95 =\$	359.80	
SUBLET	tire disposal-S	4.0 @	5.00 =\$	20.00	
15-413	valve stem-S	1.0 @	5.45 =\$	5.45	535.25
				Job Subtotal: \$655.25	

**Job04 Alignment** Sublet: \$99.95

Alignment due to new tires and damaged LF wheel.

**Job05 Misc. repairs** Labor: \$202.50

[1] Remove/straighten/paint/install front license plate bracket. [2] Lube power antenna. Needs mast replaced. Mast on order. Installation included when mast arrived. [3] Pressure test cooling system. Tighten various hose clamps that were seeping coolant. [4] Wash and vacuum, buff hood and trunk lid, minor detail.

0261974	antenna mast-S	1.0 @	41.11 =\$	41.11	41.11
				Job Subtotal: \$243.61	

----->----->----->----->----->----->----->

Continued on the next page----->----->----->----->

**Invoice No.**  
**000035331**

**Page 2**  
**Order Date 04/09/22 11:31 am**  
**Completed: 04/22/22 05:32 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**Recommendations: \*Lube, Oil and Filter\***

**Payments to Foreign Affairs**

**Status: Completed Work Order**

**Payments:**

**Cost Summary**

<b>Labor</b>	<b>997.50</b>
<b>Parts</b>	<b>680.06</b>
<b>Sublet</b>	<b>99.95</b>
<b>Enviromental</b>	<b>19.95</b>
<b>Shop Supplies</b>	<b>28.00</b>
<b>Tax</b>	<b>53.28</b>
<b>Total</b>	<b>\$1878.74</b>
<b>Payments</b>	<b>0.00</b>
<b>Bal Due</b>	<b>1878.74</b>

**Thank you for choosing Foreign Affairs**

Invoice No.  
**000034748**

**Page 1**  
Order Date 06/11/21 11:54 am  
Completed: 06/14/21 12:40 pm

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

89 Saab 900 Conv` t red  
41228 Mi.Last in 8/7/2020  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Eq:

**Job01 Repair right window** **Labor: \$250.00**

Right window won't go up. Remove door trim panel to inspect. Can close window with direct power to motor. Trace lack of power to faulty RF window switch. Replace window switch and re-install door trim panel. Also reinstall missing screw in LF door trim panel

95 01 859	RF window switch-S	1.0 @	33.05 =\$	33.05	33.05
					<b>Job Subtotal: \$283.05</b>

**Job02 Repair loose shifter** **Labor: \$375.00**

Shift lever is loose. Remove console for access. Found shifter housing had come loose due to loose/missing housing bolts that are difficult to tighten due to their design. Replace missing fasteners with standard bolts that should hold better.

**Job Subtotal: \$375.00**

Recommendations: \*Lube, Oil and Filter\*

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	625.00
Parts	33.05
Enviromental	12.50
Shop Supplies	28.00
Tax	4.60
Total	\$703.15
Payments	0.00
Bal Due	703.15

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000034127**

**Page 1**  
**Order Date 08/07/20 05:26 pm**  
**Completed: 08/13/20 02:38 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**89 Saab 900 Conv't red**  
40300 Mi. Last in 7/18/2020  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Eq:

repair dash trim, general inspect

**Job01 Repair dash trim**

**Labor: \$100.00**

**Job Subtotal: \$100.00**

**Job02 Lube, Oil & Filter**

**Labor: \$37.50**

Drain oil and refill with Castrol Edge synthetic 5W40 oil. Replace oil filter.

72161WS	oil filter-S	1.0 @	8.90 = \$	8.90	
5W40	Castrol Rdge synthetic-S	5.0 @	9.99 = \$	49.95	58.85
					<b>Job Subtotal: \$96.35</b>

**Payments to Foreign Affairs**

**Cost Summary**

Status: Completed Work Order

Payments:

<b>Labor</b>	<b>137.50</b>
<b>Parts</b>	<b>58.85</b>
<b>Enviromental</b>	<b>2.75</b>
<b>Shop Supplies</b>	<b>8.25</b>
<b>Tax</b>	<b>5.05</b>
<b>Total</b>	<b>\$212.40</b>
<b>Payments</b>	<b>0.00</b>
<b>Bal Due</b>	<b>212.40</b>

**Thank you for choosing Foreign Affairs**

**Invoice No.**  
**000034079**

**Page 1**  
**Order Date 07/18/20 10:34 am**  
**Completed: 07/24/20 02:00 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**89 Saab 900 Conv't red**  
40253 Mi. Last in 10/3/2019  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Eq:

overheat, lost coolant

**Job01 Diagnose overheating** **Labor: \$150.00**

Car towed in due to overheated, lost coolant. Coolant on ground by driver front wheel. Inspect for cause. No visible signs of leaks. Pressure test system. Cooling system does not leak during pressure test. Run engine and observe. Auxiliary fan does not run with either AC or engine heat. Engine begins to overheat when aux. fan fails to come on. Test wiring to find reason for no aux. fan. Fan runs when powered directly. Bypass time delay relay to eliminate relay as cause. Jumper fan temperature switch and fan runs. Needs aux fan temperature sender replaced.

**Job Subtotal: \$150.00**

**Job02 Replace cooling fan switch** **Labor: \$125.00**

Per Saab TSB rewire to delete time delay relay for cooling fan. Replace cooling fan switch. Top up coolant.

40 86 708	aux. fan switch-S	1.0 @	64.94 =S	64.94	
NPN	coolant-S	1.0 @	23.50 =S	23.50	88.44

**Job Subtotal: \$213.44**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	275.00
Parts	88.44
Environmental	5.50
Shop Supplies	16.50
Tax	7.90
<b>Total</b>	<b>\$393.34</b>
Payments	0.00
<b>Bal Due</b>	<b>393.34</b>

Thank you for choosing Foreign Affairs



**Invoice No.**  
**000033521**

**Page 2**  
**Order Date 10/03/19 08:44 am**  
**Completed: 10/09/19 11:48 am**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

**Job06 Repair lighting wiring**

for tail lights. After TSB performed signals work correctly.

**Job Subtotal: \$118.00**

**Job07 Misc.**

**Labor: \$0.00**

1] LF signal lamp loose at headlight. Light has broken mount tab on lamp and broken mount tab on headlight housing for signal mount. Able to secure lamp, but needs both parts replaced for full repair. 2] Clean and detail complete.

**Job Subtotal: \$0.00**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	861.40
Parts	211.01
Sublet	134.00
Enviromental	17.23
Shop Supplies	28.00
Tax	17.99
Total	\$1269.63
Payments	0.00
Bal Due	1269.63

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000033484**

**Page 1**  
**Order Date 09/18/19 10:14 am**  
**Completed: 09/28/19 12:02 pm**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

**89 Saab 900 Conv't red**  
38400 Mi. Last in 7/27/2019  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Eq:

**Job01 Repair window switches**

**Labor: \$177.00**

RR window switch pushed down out of housing. Remove window switches. At last repair, needed to glue in some switches. Now switch assembly housing is compromised. Obtain 3 new window switches and used housing with 4 switches. Mix and match new switches with replacement housing and used switch buttons. Now all window switches are clipped into position [not glued]. All 4 switches are new switches. All 4 switches light up, but color of bulbs varies. Rear switch buttons are smooth, front buttons have ridge on button. Work order mileage is approximate.

NPN-USED	switch housing ass'y-S	1.0 @	70.00 =\$	70.00	
95 01 859	window switch-S	3.0 @	30.34 =\$	91.02	161.02
					<b>Job Subtotal: \$338.02</b>

**Payments to Foreign Affairs**

**Cost Summary**

Status: Completed Work Order

Payments:

Labor	177.00
Parts	161.02
Enviromental	3.54
Shop Supplies	10.62
Tax	12.92
Total	\$365.10
Payments	0.00
Bal Due	365.10

Thank you for choosing Foreign Affairs



**Invoice No.**  
**000033354**

**Page 1**  
**Order Date 07/27/19 10:50 am**  
**Completed: 08/14/19 12:51 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

<b>89 Saab 900 Conv't red</b> 38216 Mi.Last in 6/4/2019 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Eq:
---

check/charge battery, get battery tender, low bouncy idle

<b>Job01 Battery issues</b>	<b>Labor: \$94.40</b>
-----------------------------	-----------------------

Replace weak battery under warranty. Install connector wire for battery tender. Clean and detail.

021-0123	battery tender-S	1.0 @	76.25 =\$	76.25	
26RMR	battery-S	1.0 @	0.01 =\$	0.01	76.26
					<b>Job Subtotal: \$170.66</b>

<b>Payments to Foreign Affairs</b>	<b>Cost Summary</b>	
<b>Status: Completed Work Order</b>	<b>Labor</b>	<b>94.40</b>
<b>Payments:</b>	<b>Parts</b>	<b>76.26</b>
	<b>Enviromental</b>	<b>1.89</b>
	<b>Shop Supplies</b>	<b>5.66</b>
	<b>Tax</b>	<b>6.17</b>
	<b>Total</b>	<b>\$184.38</b>
	<b>Payments</b>	<b>0.00</b>
	<b>Bal Due</b>	<b>184.38</b>

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000033226**

**Page 1**  
**Order Date 06/04/19 04:28 pm**  
**Completed: 06/14/19 03:54 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**89 Saab 900 Conv't red**  
38040 Mi. Last in 5/31/2019  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Eq:

**LR window intermittant going up, probable window motor issue**

**Job01 Repair LR window**

**Labor: \$236.00**

LR window intermittant going up. After removing rear seat, window switch pack, and LR interior trim to access and test circuits, we were able to conclude that the LR window switch was intermittant. The window switches have a relay equivilant built into the switches, making circuit diagnosis more difficult. Repair made was to replace unavailable rear switches with new front switches. Switches and mounting panel were trimmed slightly to fit front switches in rear position. Now all switches are new, and all switches light up. The original problem was one switch did not light up, and switch markings looked work on some of the switches. Hopefully the switches will continue to work without incident. Between the repair and prior repair we have well over 8 hours into working with window switches that originally had a cosmetic fault. Prior charge 1 hour labor.

95 01 859	window switch-S	1.0 @	29.00 =\$	29.00	29.00
					<b>Job Subtotal: \$265.00</b>

**Payments to Foreign Affairs**

**Cost Summary**

**Status: Completed Work Order**

**Payments:**

<b>Labor</b>	<b>236.00</b>
<b>Parts</b>	<b>29.00</b>
<b>Enviromental</b>	<b>4.72</b>
<b>Shop Supplies</b>	<b>14.16</b>
<b>Tax</b>	<b>3.25</b>
<b>Total</b>	<b>\$287.13</b>
<b>Payments</b>	<b>0.00</b>
<b>Bal Due</b>	<b>287.13</b>

**Thank you for choosing Foreign Affairs**

**Invoice No.**  
**000033211**

**Page 1**  
**Order Date 05/31/19 03:53 pm**  
**Completed: 05/31/19 04:34 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**89 Saab 900 Conv't red**  
37983 Mi. Last in 10/1/2018  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Eq:

**Job01 Repair water on floor**

**Labor: \$118.00**

Water on back seat floor after recent hard rain. Remove rear seat bottom to peel up carpets. Use wet vac and box fan to dry out rear floor. Reinstall rear seat bottom. Run water on top to see if leaking/drainage. Found right quarter panel/top drain clogged. Clean and verify top area drains on both sides.

**Job Subtotal: \$118.00**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	118.00
Parts	0.00
Enviromental	2.36
Shop Supplies	7.08
Tax	0.53
Total	\$127.97
Payments	0.00
Bal Due	127.97

**Thank you for choosing Foreign Affairs**



**Invoice No.**  
**000032680**

**Page 2**  
**Order Date 10/01/18 05:42 pm**  
**Completed: 03/15/19 01:20 pm**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

**Job05 RF seat repair** **Labor: \$70.80**

Remove RF seat and take to upholstery shop due to split seam in seat cushion. Install after repair.

SUBLET	repair RF seat cushion-S	1.0 @	260.00 =\$	260.00	260.00
					<b>Job Subtotal: \$330.80</b>

**Job06 Clean and detail** **Labor: \$125.00**

Buff hood and deck lid. Clean and detail engine. Clean interior including leather conditioner on seats and clean floor mats.  
Detail complete.

**Job Subtotal: \$125.00**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments: \$1,000.00  
1 03/08/19 1000.00 AMEX

**Cost Summary**

Labor	962.80
Parts	426.59
Enviromental	19.26
Shop Supplies	28.00
Tax	34.21
Total	\$1470.86
Payments	1000.00
Bal Due	470.86

Thank you for choosing Foreign Affairs

Invoice No.  
000032550

Page 1

Order Date 08/06/18 08:14 am  
Completed: 08/10/18 10:08 am

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

<p>89 Saab 900 Conv` t red 37150 Mi. Last in 5/21/2018 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Equipment: Profile:</p>
--

died while driving

**Job01 Diagnose/repair runability**

Labor: \$590.00

Customer states that fuel tank nearly empty, filled up with gas, and engine stalled/won't restart approx. 1/2 mile from gas station. Car towed to shop. Engine will not start. Remove spark plugs and clean fouled plugs. With plugs cleaned, engine starts, but won't keep running. Obviously, fuel and spark are both present for engine to run. Take fuel sample. Can see some water content floating on top of fuel sample. Drain fuel and add 5 gallons fresh fuel. With fresh fuel, engine runs and idles in shop. Check fuel pressure at engine. Fuel pressure is 30 psi, this is low end of fuel pressure spec. Engine will "rev up" with no load at idle. Decide to drive to gas station as test drive, and to fill tank. Engine ran under load for a few hundred yards, then stalled. Engine has no acceleration under load. Tow strap back to shop. Continue testing. Again check fuel pressure. Fuel pressure falls below 30 psi. Check air mass meter and idle control function- no change in problem. Research states that boost fuel pump is more common failure than main pump. Failing boost pump will restrict flow into main pump. Replace boost pump. When boost pump removed found some minimal debris in boost pump pick up screen, no residue in main pump screen. After boost pump installed, engine again runs longer/revs more, but still stalls. Replace main fuel pump since engine continues to act like it is running out of fuel. Mechanical fuel pressure gauge continues to show 30 psi [or slightly less] during testing. Believe the issue is fuel volume, not pressure. After main pump installed, engine again runs longer/revs up stronger. Engine still stalls out after 3-5 minutes of running with no load. Even though fuel pumps and fresh fuel improved the stalling condition, now question whether fuel related. Attach spark tester to engine to see if spark is lost when engine stalls. Spark loss is unusual, but sure enough there is no spark when engine stalls. Check cap and rotor. Both cap and rotor are burnt/running hot enough to melt top of rotor. Replace cap and rotor. Now engine starts/runs with authority. Run to gas station and fill tank. Conclusion is that underlying problem was failed ignition components. Timing of the ignition problem with gas fill up was coincidence. There was some water in gas, but this was not an issue. Since fuel pump replacement had positive result of helping engine to run, these parts were left in at a reduced rate. Fuel pumps believed original to the car. Car now has new cap, rotor, spark plugs, fuel filter, boost pump [list \$167], and main fuel pump [list \$333]. Work order mileage approximate.

NPN	fuel-S	1.0 @	17.02 =\$	17.02
3507436	boost pump-S	1.0 @	110.00 =\$	110.00
61 447	fuel pump-S	1.0 @	250.00 =\$	250.00
03 010	distributor cap-S	1.0 @	17.70 =\$	17.70
04 168	rotor-S	1.0 @	31.00 =\$	31.00
NPN	fuel-S	1.0 @	0.00 =\$	0.00

**Job Subtotal: \$1,015.72**

**Payments to Foreign Affairs**

**Cost Summary**

Labor	590.00
Parts	425.72

----->----->----->---Continued on the next page--->----->----->----->

**Invoice No.**  
**000032550**

**Order Date 08/06/18 08:14 am**  
**Completed: 08/10/18 10:08 am**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**Payments to Foreign Affairs**

**Cost Summary**

<b>Enviromental</b>	<b>11.80</b>
<b>Shop Supplies</b>	<b>28.00</b>
<b>Tax</b>	<b>34.15</b>
<b>Total</b>	<b>\$1,089.67</b>
<b>Payments</b>	<b>0.00</b>
<b>Bal Due</b>	<b>1,089.67</b>

**Status: Completed Work Order**

**Payments:**

**Thank you for choosing Foreign Affairs**

**MACH 1 THE SPEED OF SOUND**  
8580 EXCELSIOR BLVD

**THANK YOU**

001  
P

**INVOICE**

Created On: 03/12/2018

HOPKINS MN 55343-  
(952) 933-7357 Fax: (952) 933-8498  
www.mach1-audio.com

INVOICE	TYPE	DATE	TIME	PAGE#	
A	34628	RETAIL	05/22/2018	11:33:30 AM	1

CUSTOMER INFORMATION	
VIP#	
Cell:	

DEALER INFORMATION	
ID#	
Ext:	
STK:	PO: RO:

AUTOMOBILE DESCRIPTION	
Make: SAAB	Model: 9000
Year: 1989	Color:
VIN#:	
Odometer:	
Registration:	

APPOINTMENT INFORMATION	
Sales1: Anna	Day: Monday Bay#: 0
Sales2:	Date: 05/21/2018
Start Time: 01:56 PM	Stop Time: 01:56 PM

JOB DESCRIPTION	
please remove sirius xm antenna Talk to Dick from Foreign Affairs about getting and taking car	

QTY.	MODEL	MAKE	DESCRIPTION	SERIAL NO.	PRICE	SUBTOTAL
1	DEHX8800BHS	PIONEER	HD Radio/BT/USB/Aux/SXM Ready	QGUE008586UC	\$179.99	\$179.99
-1	SALE	MACH 1	Inventory Blowout Sale	SALE	\$20.00	-\$20.00
-1	DEHX6800BS	PIONEER	AM/FM/CD/BT Receiver	DEHX6800BS	\$119.99	-\$119.99
1	SALE	MACH 1	Anniversary Sale	SALE	\$36.00	\$36.00

LABOR/SUBLET DESCRIPTION
SUBLET:

Materials:	\$76.00
Labor:	\$0.00
Sublet:	\$0.00
Other:	\$0.00
Misc:	\$0.00
SubTotal:	76.00
Sales Tax:	\$5.72
<b>Invoice</b>	<b>\$81.72</b>

TERMS & CONDITIONS
All materials have a manufacturer warranty and installation is guaranteed for one year. Installation kits, filters, wiring harnesses are additional charges if needed. Engine noise removal may be necessary after component install.
SEVEN DAY RETURN POLICY. NO REFUNDS on installed equipment. Payment by check requires a 10 day waiting period for refund.
Visit our website: <Insert Your Company website here>
Signature below constitutes awareness that is against the law to operate television/video in the view of the driver while the vehicle is in motion. Herein Company is not responsible or liable for any accidents or fines for customer's failure to abide by this law.
X _____ Date _____

HOW PAID	
Paid Cash :	
Paid Charge :	\$81.72
Card Info : AMEX*****	2109
Auth. Code :	
Gift Card:	
Gift Cert:	
Paid Check : Chk#	
Paid House :	
A/R Open : Due:	
Deposit : Type: CHRG	\$81.72
Last Paid: 05/21/2018 CHRG	\$81.72
Balance	



**Invoice No.**  
**000032347**

**Page 1**  
**Order Date 05/21/18 02:34 pm**  
**Completed: 05/23/18 09:59 am**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

**89 Saab 900 Conv't red**  
35638 Mi. Last in 5/4/2018  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Equipment:  
Profile:

repair both door windows. Right door window sticks going down, left is noisy.

**Job01 Repair door windows** **Labor: \$271.40**

1| Right window only goes down a few inches. Remove interior trim panel for repairs. Found rear window track bolts fallen out, one in car, and one in bottom of door. Tighten window track back in place. Lube/adjust mechanism. Window works well.  
2| Driver window noisy during up/down travel. Remove interior trim panel for repairs. Found left door window regulator has had prior repairs. Wrong length bolts are hitting during operation. Replace questionable bolts with shorter bolts. Lube/adjust mechanism. Left window works well, but is slower than right side due to prior repair and more use of driver window.

**Job Subtotal: \$271.40**

**Payments to Foreign Affairs**

**Cost Summary**

Status: Completed Work Order

Payments:

Labor	271.40
Parts	0.00
Enviromental	5.43
Shop Supplies	16.28
Tax	1.23
Total	\$294.34
Payments	0.00
Bal Due	294.34

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000032317**

**Page 1**  
**Order Date 05/04/18 11:08 am**  
**Completed: 05/15/18 01:09 pm**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

**89 Saab 900 Conv't red**  
35347 Mi. Last in 3/12/2018  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Equipment:  
Profile:

misfire on hard acceleration, gas smell in cabin

**Job01 Repair fuel smell** **Labor: \$177.00**

Customer states fuel smell present since car picked up. Do smell slight fuel smell. Car arrived with fuel almost empty. Fill fuel to help check fuel smell. Inspect for fuel leak. Found small fuel hose from fuel rail to pressure regulator is dripping on top of engine at a slow rate. This is a plastic hose with rubber cover that is shrink fit to metal ends. Hose not readily available. Trim plastic hose from metal ends. Replace plastic hose with rubber fuel injection hose clamped at both ends. Leak is resolved.

NPN	fuel hose & clamps-S	1.0 @	6.82 =\$	6.82
NPN	fuel-S	1.0 @	25.34 =\$	25.34

**Job Subtotal: \$209.16**

**Job02 Rough run** **Labor: \$94.40**

Engine runs rough/misfires at 4000 rpm's and up. Misfire improved when fuel leak repaired, but still present. Replace spark plugs. Engine runs smooth up to redline with new spark plugs.

6282	NGK spark plugs-S	4.0 @	4.77 =\$	19.08
------	-------------------	-------	----------	-------

**Job Subtotal: \$113.48**

**Job03 Replace valve cover gasket** **Labor: \$0.00**

Warranty repair, replace valve cover gasket due to still leaking at front lower corner. Leak creating slight burnt oil smell.

88 22 041	valve cover gasket-S	1.0 @	0.00 =\$	0.00
-----------	----------------------	-------	----------	------

**Job Subtotal: \$0.00**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	271.40
Parts	51.24
Enviromental	5.43
Shop Supplies	16.28
Tax	5.09
Total	\$349.44
Payments	0.00
Bal Due	349.44

Thank you for choosing Foreign Affairs



Invoice No.  
**000032204**

Page 2  
Order Date 03/12/18 08:26 am  
Completed: 04/27/18 10:58 am

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

### Job05 Replace valve cover gasket

88 22 041	valve cover gasket-S	1.0 @	28.79 =S	28.79
NPN	Brakleen spray cleaner-S	4.0 @	3.99 =S	15.96
				<b>Job Subtotal: \$221.75</b>

### Job06 Replace waterpump & belts

**Labor: \$413.00**

Waterpump leaking coolant due to failed gasket. Water pump bearing is slightly rough. Belts are dried out/cracking. Replace waterpump and belts. Fill coolant.

88 17 900	water pump-S	1.0 @	33.67 =S	33.67
93 185 052	belt set [2]-S	1.0 @	10.62 =S	10.62
13 X 1175	belt-S	1.0 @	19.42 =S	19.42
10 X 825	belt-S	1.0 @	9.53 =S	9.53
NPN	coolant-S	1.0 @	21.50 =S	21.50
				<b>Job Subtotal: \$507.74</b>

### Job07 Repair HVAC

**Labor: \$472.00**

Heater control stuck hot from lack of use. Temperature knob seems disconnected from heater valve. AC compressor does not turn on. Temperature control needs to be on "cold" for compressor to run. Start with repair hot/cold knob. Disassemble heater control panel and left upper dash for access to knob linkage and heater valve. Found linkage rod plastic end broken at heater valve. Obtain good used linkage rod and install. Spray penetrant on heater valve and work free. Heater valve now turns freely hot to cold when temperature knob is turned. Now when temperature is in blue zone, AC compressor will come on. AC blows cold with no repairs. Car now has heat and AC. Heat is adjustable cool to hot.

NPN-USED	hot/cold linkage rod-S	1.0 @	40.00 =S	40.00
				<b>Job Subtotal: \$512.00</b>

### Job08 Misc. cosmetic repairs

**Labor: \$295.00**

1| Apply multiple coats of leather conditioner to soften seat leather. 2| Remove rear seat for upholstery repairs- split seam. Seat required re-sew all seams due to dried out/breaking thread. Also sew loose heel pad on driver floor mat and torn snap on owners manual packet. Reinstall seat. 3| Remove rear seat speaker covers and reglue loose trim covering on speaker covers. 4| Remove stickum from RF speaker cover after stereo installer removed attached device. 5| Find longer screw to hold RR under dash panel that is loose where amp/speaker wires run to under pass. seat. 6| Remove/install driver door interior trim panel to repair/dye door trim. 7| Glue loose/broken seat release lever onto right seat. 8| Replace missing screws in right side dash speaker grille.

NPN	leather treatment-S	1.0 @	18.95 =S	18.95
SUBLET	rear seat repair-S	1.0 @	290.00 =S	290.00
SUBLET	Lt. door trim repair-S	1.0 @	185.00 =S	185.00
				<b>Job Subtotal: \$788.95</b>

### Job09 Misc. mechanical repairs

**Labor: \$354.00**

1| lube all hinges/latches/locks 2| reroute/repair radio wire melting by exhaust 3| Replace burnt out RR outer brake bulbs. Replace defogger switch, left mirror switch, main light switch and bulb due to malfunctions present.

----->----->----->----->----->----->----->----->----->

**Invoice No.**  
**000032204**

**Page 3**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

**Order Date 03/12/18 08:26 am**  
**Completed: 04/27/18 10:58 am**

**Job09 Misc. mechanical repairs**

1156	brake light bulb-S	2.0 @	2.27 =	\$ 4.54
NPN- USED	defogger switch-S	1.0 @	25.00 =	\$ 25.00
NPN-USED	4-way mirror switch-S	1.0 @	25.00 =	\$ 25.00
NPN-USED	headlight switch-S	1.0 @	40.00 =	\$ 40.00

**Job Subtotal: \$448.54**

**Job10 General maintenance**

**Labor: \$118.00**

1] Replace original fuel filter. 2] Check fluids, tire pressure, etc.

31262352	fuel filter-S	1.0 @	39.45 =	\$ 39.45
----------	---------------	-------	---------	----------

**Job Subtotal: \$157.45**

**Job11 "TO DO"**

**Labor: \$0.00**

1] rubber sleeve missing from hood release handle under dash. 2] fog lights removed from below front bumper 3] headlights have light clouding that would require remove light and internally clean 4] monitor for oil leak from pan gasket or other gaskets below valve cover gasket 5] valve tick or possibly exhaust tick when engine first started. Monitor ticking noise. May improve with exercise.

**Job Subtotal: \$0.00**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments: \$2,000.00  
1 03/27/18 2000.00 Check

**Cost Summary**

Labor	2,291.40
Parts	973.97
Sublet	125.00
Enviromental	45.83
Shop Supplies	28.00
Tax	75.40
Total	\$3,539.60
Payments	2,000.00
Bal Due	1,539.60

Thank you for choosing Foreign Affairs

# VEHICLE INSPECTION FORM

YEAR 89 MAKE SAAB MODEL 900 Turbo

PRODUCTION DATE 3/89 ENG SIZE \_\_\_\_\_  
 LIC PLATE / STATE 8BDR563 TRANS AUTO / MANUAL  
 MILEAGE 35064 COLOR red

1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17  
MIS13A7175L3K71020477

INSPECT	OK	SUG	REQ	WHY RECOMMENDED
WIPER BLADES	X			<input type="checkbox"/> FRONT <input type="checkbox"/> REAR
HEADLIGHTS	X			
MINI LIGHTS	X			<input type="checkbox"/> BRAKE <input type="checkbox"/> TURN <input type="checkbox"/> LICENSE <input type="checkbox"/> PARKING
AIR FILTER	X			
CABIN AIR FILTER	X			
PCV VALVE	X			
WASHER FLUID	X			
OIL LEVEL	X			
POWER STR. FLUID LEVEL	X			OVER 50K: Y / N
MASTER CYL. FLUID LEVEL	X			<input type="checkbox"/> BRAKE INSPECTION
BRAKE FLUID FLUSH	X			<input type="checkbox"/> FLUSH <input type="checkbox"/> PAN SERVICE
TRANS. SERVICE	X			
COOLANT LEVEL FLUSH	X			
COOLANT HOSES	X			<input type="checkbox"/> UPPER <input type="checkbox"/> LOWER <input type="checkbox"/> BYPASS <input type="checkbox"/> HEATER
BELTS	X			<input type="checkbox"/> ALT <input type="checkbox"/> A/C <input type="checkbox"/> P/S <input type="checkbox"/> AIR BELTS 1 2 3 4
BATTERY TEST	X			<input type="checkbox"/> GOOD <input type="checkbox"/> MARGINAL <input type="checkbox"/> REPLACE
BATTERY ACCESSORIES	X			<input type="checkbox"/> CABLE ENDS / CABLES <input type="checkbox"/> CLIP FOR NEG <input type="checkbox"/> HOLD DOWN
BATTERY	X			<input type="checkbox"/> CORROSION <input type="checkbox"/> PREVENTATIVE
START/CHARGE TEST	X			
BELT TENSIONER	X			
SPARK PLUGS	X			
FUEL FILTER	X			<i>mileage 192</i>
IGNITION WIRES	X			
VALVE COVER GASKET	X			<i>leaking</i>
POWER STR. HOSE	X			<input type="checkbox"/> PRESSURE <input type="checkbox"/> RETURN
TIMING BELT	X			

TIRE SIZE		TIRE BRAND / MODEL	
F			
R			

INSPECT	OK	SUG	REQ	WHY RECOMMENDED
LEFT FRONT				<input type="checkbox"/> CUPPING <input type="checkbox"/> BEAD LEAK <input type="checkbox"/> CRACKING <input type="checkbox"/> NAIL / SCREW <input type="checkbox"/> SIDEWALL <input type="checkbox"/> VALVE STEM
PSI IN				
PSI OUT				
RIGHT FRONT				<input type="checkbox"/> CUPPING <input type="checkbox"/> BEAD LEAK <input type="checkbox"/> CRACKING <input type="checkbox"/> NAIL / SCREW <input type="checkbox"/> SIDEWALL <input type="checkbox"/> VALVE STEM
PSI IN				
PSI OUT				
RIGHT REAR				<input type="checkbox"/> CUPPING <input type="checkbox"/> BEAD LEAK <input type="checkbox"/> CRACKING <input type="checkbox"/> NAIL / SCREW <input type="checkbox"/> SIDEWALL <input type="checkbox"/> VALVE STEM
PSI IN				
PSI OUT				
LEFT REAR				<input type="checkbox"/> CUPPING <input type="checkbox"/> BEAD LEAK <input type="checkbox"/> CRACKING <input type="checkbox"/> NAIL / SCREW <input type="checkbox"/> SIDEWALL <input type="checkbox"/> VALVE STEM
PSI IN				
PSI OUT				
SPARE				<input type="checkbox"/> CUPPING <input type="checkbox"/> BEAD LEAK <input type="checkbox"/> CRACKING <input type="checkbox"/> NAIL / SCREW <input type="checkbox"/> SIDEWALL <input type="checkbox"/> VALVE STEM
PSI IN				
PSI OUT				
TIRE MAINT				<input type="checkbox"/> ROTATION <input type="checkbox"/> BALANCE
ALIGNMENT				<input type="checkbox"/> MAINTENANCE <input type="checkbox"/> TIRE WEAR

STEERING AND SUSPENSION				
U-JOINT				<input type="checkbox"/> FRONT <input type="checkbox"/> REAR
IDLER/PITMAN ARM				<input type="checkbox"/> IDLER <input type="checkbox"/> PITMAN
CENTERLINK				
BUSHINGS				<input type="checkbox"/> CONTROL ARM <input type="checkbox"/> SWAY BAR <input type="checkbox"/> FRONT <input type="checkbox"/> REAR
WHEEL BEARINGS				<input type="checkbox"/> FRONT LEFT <input type="checkbox"/> FRONT RT <input type="checkbox"/> REAR LEFT <input type="checkbox"/> REAR RT
TIE ROD ENDS				<input type="checkbox"/> L OUT <input type="checkbox"/> L IN <input type="checkbox"/> R OUT <input type="checkbox"/> R IN
BALL JOINTS				<input type="checkbox"/> L UP <input type="checkbox"/> L LWR <input type="checkbox"/> R UP <input type="checkbox"/> R LWR
RACK & PINION ASSEMBLY				
CV BOOTS				<input type="checkbox"/> L OUT <input type="checkbox"/> L IN <input type="checkbox"/> R OUT <input type="checkbox"/> R IN
CV JOINTS				<input type="checkbox"/> L OUT <input type="checkbox"/> L IN <input type="checkbox"/> R OUT <input type="checkbox"/> R IN
STRUTS				<input type="checkbox"/> FRONT LEFT <input type="checkbox"/> FRONT RT <input type="checkbox"/> REAR LEFT <input type="checkbox"/> REAR RT
SHOCKS				<input type="checkbox"/> FRONT LEFT <input type="checkbox"/> FRONT RT <input type="checkbox"/> REAR LEFT <input type="checkbox"/> REAR RT


INSPECT	OK	SUG	REQ	WHY RECOMMENDED
FRONT PADS	X			LF N.M. <input type="checkbox"/> SENSOR <input type="checkbox"/> RR N.M.
FRONT CALIPERS	X			YES / NO
FRONT ROTORS	X			
REAR PADS	X			LR N.M. <input type="checkbox"/> SENSOR <input type="checkbox"/> RR N.M.
REAR CALIPERS	X			YES / NO
REAR ROTORS	X			
HARDWARE	X			<input type="checkbox"/> FRONT <input type="checkbox"/> REAR
E-BRAKE CABLE	X			<i>Visual</i>
FRONT BRAKE HOSES	X			
REAR BRAKE HOSES	X			
WHEEL CYLINDERS	X			

IMPROVED PERFORMANCE SUGGESTIONS	
BRAKE FLUSH	EVERY 2 YEARS
POWER STR. FLUSH	EVERY 50K
FUEL SYSTEM SERVICE	EVERY 12K
TRANS FLUSH	EVERY 1 - 2 YEARS
WHEEL ALIGNMENT	EVERY 6 MONTHS
COOLANT FLUSH	EVERY 1 - 2 YEARS
WHEEL BALANCE	EVERY ROTATION

EXHAUST	
EXHAUST SYSTEM	<input type="checkbox"/> MANIFOLD <input type="checkbox"/> DOWN <input type="checkbox"/> FLEX <input type="checkbox"/> CAT <input type="checkbox"/> O2 <input type="checkbox"/> MUFFLER

OK Checked & Accepted	REPAIR/REPLACEMENT SUGGESTED	REPAIR/REPLACEMENT REQUIRED
	1. Close to end of useful life 2. Address customer request/need/convenience 3. Comply with manufacturer recommendation 4. Technician recommendation from experience	A. No longer performs intended purpose B. Does not meet design specification C. Missing

VEHICLE DAMAGE	
CRACKED WINDSHIELD	YES / NO
SCRATCHES DENTS	YES / NO
MISSING TRIM	YES / NO

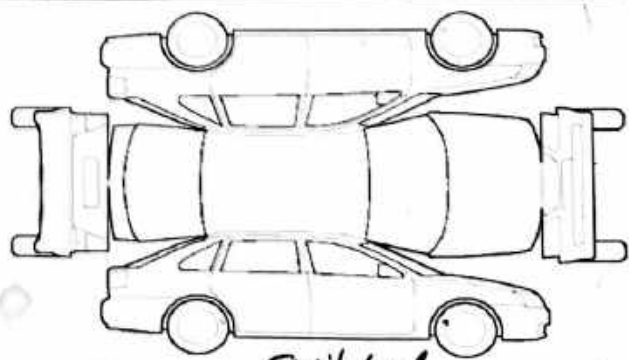

NOTES *A/c does not work rear window switches switched around*  
*LF headlight bracket broken fog lights missing*  
*valve cover split gasket and head gasket*  
*water pump*

# MACH 1 THE SPEED OF SOUND

8580 EXCELSIOR BLVD

HOPKINS MN 55343-  
 (952) 933-7357 Fax: (952) 933-8498  
 www.mach1-audio.com

## THANK YOU

001  
P

DUPLICATE Created On: 03/12/2018

INVOICE	TYPE	DATE	TIME	PAGE#
A 33955	RETAIL	4/19/2018	10:39:52 AM	1

CUSTOMER INFORMATION	
VIP#	
Cell:	
GOOGLE	

DEALER INFORMATION		
ID#		
STK:	PO:	RO:

AUTOMOBILE DESCRIPTION		
Make: SAAB	Model: 9000	
Year: 1989	Color:	
VIN#:		
Odometer:		
Registration:		

APPOINTMENT INFORMATION		
Sales1: Anna	Day: Thursday	Bay#: 2
Sales2:	Date: 04/19/2018	
Start Time: 09:00 AM	Stop Time: 10:30 AM	

### JOB DESCRIPTION:

please remove sirius xm antenna  
 Talk to Dick from Foreign Affairs about getting and taking car

QTY.	MODEL	MAKE	DESCRIPTION	SERIAL NO.	PRICE	SUBTOTAL
1	DEHX6800DS	PIONEER	AM/FM/CD/BT Receiver	PETM000575UC	\$119.99	\$119.99
-1	SALE	MACH 1	anniversary sale	SALE	\$36.00	-\$36.00
1	MACH1	LABOR	radio with Bluetooth	KLC;1	\$70.00	\$70.00
1	MACH1	LABOR	hardwire radio	KLC;1	\$50.00	\$50.00
1	SHOP	SUPPLIES	STANDARD SHOP SUPPLIES	SHOP	\$8.00	\$8.00

LABOR/SUBLET DESCRIPTION
SUBLET:

Materials:	\$91.99
Labor:	\$120.00
Sublet:	\$0.00
Other:	\$0.00
Misc:	\$6.00
SubTotal:	217.99
Sales Tax:	\$15.96
<b>Invoice</b>	<b>\$233.95</b>

TERMS & CONDITIONS
All materials have a manufacturer warranty and installation is guaranteed for one year. Installation kits, filters, wiring harnesses are additional charges if needed. Engine noise removal may be necessary after component install.
SEVEN DAY RETURN POLICY. NO REFUNDS on installed equipment. Payment by check requires a 10 day waiting period for refund.
Visit our website: <Insert Your Company website here>
Signature below constitutes awareness that it is against the law to operate television/lights in the view of the driver while the vehicle is in motion. Hermin Company is not responsible or liable for any accidents or fines for customer's failure to abide by this law.
X _____ Date _____

HOW PAID	
Paid Cash :	
<b>Paid Charge :</b>	<b>\$233.95</b>
Card Info : M/C*****	1907
Auth. Code :	
Gift Card:	
Gift Cert:	
<b>Paid Check : Chk#</b>	
Paid House :	
A/R Open : Due:	
Deposit : Type: CHRG	\$233.95
Last Paid: 4/18/2018 CHRG	\$233.95
Balance	

# Smog Check Vehicle Inspection Report (VIR)

## Vehicle Information

Test Date/Time: 09/23/2017 @ 14:21

Model Year: 1989	Make: SAAB	Model: 900 TURBO
License: NONE	State: Unknown	VIN: YS3AT75L3K7020477
Engine Size: 2.0 L	Type: Passenger	Transmission: Manual
GVWR: N/A	Test Weight: 3250	Cylinders: 4
Odometer: 34949	Certification: California	VLT Record #: 21488
Fuel Type: Gasoline	Exhaust: Single	Inspection Reason: Initial Registration

## Overall Test Results

**Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.**

Smog Check Certificate Number: HF410962  
DMV ID Number: 7005F747H737

Your Smog Check certificate has been electronically transmitted to DMV.  
Your certificate is valid for 90 days from date of issuance.  
Please keep this copy for your records.

## Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test)

Result	<u>ECS</u>	Result	<u>ECS</u>	Result	<u>ECS</u>
Pass	PCV	N/A	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	N/A	Air Injection	Pass	OBD System Checks
N/A	EGR Visual	Pass	Vacuum Lines to Sensors/ Switches	Pass	Carb./Fuel Injection
N/A	EGR Functional		Ignition Timing: 16 BTDC	Pass	Other Emission Related Components
Pass	Fuel Cap Functional	Pass	Wiring to Sensors	Pass	Oxygen Sensor
Pass	Fuel Cap Visual	Pass	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Pass	Spark Controls				
Pass	Fuel Evaporative Controls Functional				

## ASM Emission Test Results

Test	RPM	%CO <sub>2</sub>		HC (PPM)			CO (%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1754	15.2	0.1	116	35	45	0.52	0.11	0.25	791	313	622	PASS
25 mph	1975	15.1	0.0	63	26	27	0.62	0.08	0.13	730	237	469	PASS

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

No match has been found or test has been performed offline. The Consumer is responsible for retaining the VIR for reference throughout the vehicle registration process.


## Smog Check Inspection Station Information

Walnut Creek Smog  
1433 MAZDA DR. WALNUT CREEK CA 94597  
925-938-1646  
Station Number: TC265101

Technician Name/Number: DELACUADRA, JOSEPH/EO639485  
Repair Tech Name/Number:  
Software Version/EIS Number: 1301/ES315703

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

9/23/17  
Date

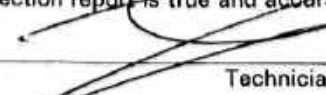  
Technician's Signature





# Dirito Brothers

WALNUT CREEK

1890 North Main Street  
WALNUT CREEK, CALIFORNIA 94596-4195  
(925) 934-8224

CALIF. B.A.R. REG. # 257857  
EPA # CAL000300319

CUSTOMER NO. <b>56974</b>	ADVISOR <b>TERI</b>	1114	TAG NO. <b>978</b>	INVOICE DATE <b>05/14/09</b>	INVOICE NO. <b>SACS11696</b>
	LICENSE NO. <b>CARDNAL</b>		MILEAGE <b>32,084</b>	COLOR <b>RED/</b>	STOCK NO.
	YEAR / MAKE / MODEL <b>89/SAAB/900 CONV, 16VT, M/T</b>			DELIVERY DATE	DELIVERY MILES
	VEHICLE ID NO. <b>Y S 3 A T 7 5 L 3 K 7 0 2 0 4 7 7</b>			SELLING DEALER NO.	PRODUCTION DATE
	F.T.E. NO.		P.O. NO.	R.O. DATE <b>04/21/09</b>	
RE	COMMENTS				MO: 32084

LABOR & PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	TOTAL
<b>J# 1 04SAZ21</b> MANUAL TRANS CONCERN TECH(S):1212 45.00 CUST STATES CANNOT GET INTO REVERSE. PLEASE CHECK AND ADVISE FOUND GEAR SHIFT KNOB TO LOW ON SHAFT REPLACED GEAR SHIFT KNOB AND RECHECKED. OKAY AT THIS TIME.					
PARTS	1	75-44-828	GEARSHIFT KNOB	43.60	43.60
PARTS	1	87-18-439	WASHER	3.00	3.00
				JOB # 1 TOTAL PARTS	46.60
				JOB # 1 TOTAL LABOR & PARTS	91.60
<b>J# 2 04SAZ1</b> CLUTCH TECH(S):1212 225.00 CUST STATES GRINDS IN ALL GEARS. PLEASE CHECK AND ADVISE FOUND CLUTCH MASTER CYLINDER LEAKING INTERNALLY REPLACED CLUTCH MASTER CYLINDER AND BLEED SYSTEM					
PARTS	1	89-44-977	MASTER CYLINDER	194.00	194.00
				JOB # 2 TOTAL PARTS	194.00
				JOB # 2 TOTAL LABOR & PARTS	419.00
<b>J# 3 03SAZ07</b> BATTERY TECH(S):1212 75.00 CUST STATES BATTERY KEEPS BEING DRAINED. PLEASE CHECK AND ADVISE FOUND BATTERY DEAD CHARGED BATTERY AND TESTED 12.63V FAILED CHECKED DRAW FOUND 60 MILLIAMPS RECHECKED DRAW, FOUND 26 MILLIAMPS. OKAY AT THIS TIME REPLACED BATTERY AND CLEANED CABLES.					
PARTS	1	02-50-191	BATTERY A26RWRN	93.95	93.95
				JOB # 3 TOTAL PARTS	93.95
				JOB # 3 TOTAL LABOR & PARTS	168.95
<b>J# 4 01SA5995</b> OIL & FILTER CHANGE TECH(S):1212 30.50 CHANGE ENGINE OIL AND FILTER CHECK AND TOP OFF FLUID LEVELS PERFORMED OIL, LUBE AND FILTER CHANGE. TOPPED OFF FLUIDS, SET TIRE PRESSURES					
PARTS	1	PKLOF	LUBE OIL FILTER	****	****
PARTS	1	93-186-554	OIL FILTER	9.60	9.60
PARTS	4	02-21-317	OIL FULLSYN WTY	8.10	32.40
PARTS	1	91-32-937	SEAL WASHER	2.50	2.50
				JOB # 4 TOTAL PARTS	44.50
				JOB # 4 TOTAL LABOR & PARTS	75.00
<b>J# 5 07SAZ18</b> ROTATE TIRES TECH(S):1212					

Thank you for choosing  
**Dirito Brothers**  
as your Servicing Dealer.

**WE APPRECIATE  
YOUR BUSINESS.**

**NOTICE TO CUSTOMER:  
PLEASE READ IMPORTANT  
INFORMATION ON BACK.**

1981-0802.1 American Std. For Bus. 510.538.9906

do not smoke, drink  
 not be exposed to  
 parts, and parts  
 components  
 harm. The  
 vehicles.  
 AB

# Dirito Brothers

WALNUT CREEK

1890 North Main Street  
 WALNUT CREEK, CALIFORNIA 94596-4195  
 (925) 934-8224

CALIF. B.A.R. REG. # 257857  
 EPA # CAL000300319

CUSTOMER NO. <b>56974</b>	ADVISOR <b>TERI</b>	TAG NO. <b>1114 978</b>	INVOICE DATE <b>05/14/09</b>	INVOICE NO. <b>SACS11696</b>
	LICENSE NO. <b>CARDNAL</b>	MILEAGE <b>32,084</b>	COLOR <b>RED/</b>	STOCK NO.
	YEAR / MAKE / MODEL <b>89/SAAB/900 CONV, 16VT, M/T</b>		DELIVERY DATE	DELIVERY MILES
	VEHICLE I.D. NO. <b>Y S 3 A T 7 5 L 3 K 7 0 2 0 4 7 7</b>		SELLING DEALER NO.	PRODUCTION DATE
	F.T.E. NO.	P.O. NO.	R.O. DATE <b>04/21/09</b>	
COMMENTS				MO: 32084

CUSTOMER REQUESTS TIRE ROTATION  
 .35  
 ROTATE NOT NEEDED FOUND 8/32F 5/32R

PARTS-----QTY---FP-NUMBER-----DESCRIPTION-----	UNIT PRICE-
	JOB # 5 TOTAL PARTS 0.00
	JOB # 5 TOTAL LABOR & PARTS 0.00

MISC-----CODE-----DESCRIPTION-----CONTROL NO-----	
JOB # 1 D5 SA LABOR DISCOUNTS/COUPONS	-25.00
JOB # 1 D13 SA PARTS DISCOUNTS/COUPONS	-25.00
TOTAL - MISC	-50.00

ESTIMATE-----  
 CUSTOMER HEREBY ACKNOWLEDGES RECEIVING  
 ORIGINAL ESTIMATE OF \$440.00 (+TAX)  
 APPROVED REVISED ESTIMATE (# 1) OF \$950.00 (+TAX) ON 05/06/09 AT 04:53pm  
 BY GARY COMMENTS MASTER CYLINDER, KNOB & DRAW  
 TOTALS-----

*****	TOTAL LABOR....	375.50
*	TOTAL PARTS....	379.05
* [ ] CASH [ ] CHECK [ ] CK NO.	TOTAL SUBLET...	0.00
*	TOTAL G.O.G....	0.00
* [ ] VISA [ ] MASTERCARD	TOTAL MISC CHG.	0.00
*	TOTAL MISC DISC	-50.00
* [ ] OTHER [ ] A/R	TOTAL TAX.....	35.06
* DATE PAID / / CASHIERS INITIALS	<b>TOTAL INVOICE \$</b>	<b>739.61</b>
*****		

WE THANK YOU FOR YOUR BUSINESS

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN  
 INCREASE IN THE ORIGINAL ESTIMATED PRICE

CUSTOMER SIGNATURE

Thank you for choosing  
**Dirito Brothers**  
 as your Servicing Dealer.

WE APPRECIATE  
 YOUR BUSINESS.

NOTICE TO CUSTOMER:  
 PLEASE READ IMPORTANT  
 INFORMATION ON BACK.



INVOICE WH: 20

AUTOHAUS, INC.  
 AUTOHAUS AUTOMOTIVE, INC.  
 2575 MONUMENT BLVD.  
 CONCORD, CA. 94520-3101  
 LIC. #E23799 LIC. #AD087154  
 925-825-7111

NUMBER: 126992  
 PAGE: 1  
 DATE: 06/15/07  
 TERMS: CASH

TERMS STRICTLY CASH UNLESS OTHER ARRANGEMENTS ARE MADE. A late charge at the rate of 1 1/2% per month or 18% per year will be charged on past-due accounts.

SOLD TO:

SHIP TO:

SALES OR	DATE SHIPPED	SHIPPED VIA	3454	SLSM
----------	--------------	-------------	------	------

ORDERED	SHIPPED	BACK ORD.	ITEM NO.	DESCRIPTION	UNIT PRICE	UNIT	AMOUNT
074376	06/12/07		925-962-9414	NONE		EA	684
				VIN#: YS3AT75L3K7020477 1989 SAAB 900 TURBO INSTAL DECK WITH XM RADIO			
1	1	0	ALPCDA-9885	CD MP3 REC FULL SPEED IPO	349.99	EA	349.99
1	1	0	TRKXMD1000	UNIVERSAL XM TUNER BOX	59.99	EA	59.99
1	1	0	TRKXMDALP100	SMART DIGITAL ADAPTER	59.99	EA	59.99
1	1	0	MET40-VW10	AFTRMKT RADIO TO VW ANT.	11.00	EA	11.00
2.00	2.00	.00	LABOR660		75.00	HR	150.00
				INSTALL AMP AND SPKRS			
1	1	0	ALPSPS-10C2	S SERIES 4" COAX	79.99	EA	79.99
1	1	0	ALPSPS-17C2	S SERIES 6.5 COAX	85.00	EA	85.00
1	1	0	ALPMRP-F250	V-PWR 4/3/2 4X50	199.95	EA	199.95
1	1	0	PGIAKIT8	COMPLTETE 375W INST.KIT 8	30.00	EA	30.00
2	2	0	PGIARX.630	10" (3.0M) GOLD CABLES	20.00	EA	40.00
1.50	1.50	.00	LABOR660		75.00	HR	112.50
1.50	1.50	.00	LABOR628		75.00	HR	112.50
1	1	0	CC		.00	EA	.00

SPECIAL INSTRUCTIONS:

ALL PARTS NEW UNLESS OTHERWISE STATED.  
 ELECTRICAL AND SPECIAL-ORDER PARTS ARE NON-RETURNABLE.  
 WARRANTY AND RETURN REQUESTS MUST BE ACCOMPANIED BY RECEIPT.

MINIMUM CHARGE FOR DIAGNOSIS OF ANY AUTO AIR CONDITIONER IS OUR ADVERTISED MINIMUM, PLUS PARTS AND FREON.

WARRANTY NOTICE

STATEMENT CONCERNING AMENDMENTS TO THE SONG-BEVERLY WARRANTY ACT AS FOLLOWS:

"A buyer of this product in California has the right to have this products serviced or repaired during the warranty period. The warranty period will be extended for the number of whole days that the product has been out of the buyer's hands for warranty repairs. If a defect exists within the warranty period, the warranty will not expire until the defect has been fixed. The warranty period will also be extended if the warranty repairs have not been performed due to delays caused by circumstances beyond the control of the buyer, or if the warranty repairs did not remedy the defect and the buyer notifies the manufacturer or seller of the failure of the repairs within 60 days after they were completed. If, after a reasonable number of attempts, the defect has not been fixed, the buyer may return this product for a replacement or a refund, subject in either case, to deduction of a reasonable charge for usage. This time extension does not affect the protections or remedies the buyer has under other laws."

An estimate where requested or required for labor and parts necessary for a specific job shall be given to the customer / the service dealer in writing and the service dealer may not charge for work done or parts supplied in excess of the estimate without prior consent of the customer. The service dealer may charge a reasonable fee for making the estimate.

I hereby authorized the above work to be done along with the necessary parts and materials. An express mechanics lien hereby acknowledged on the above car to secure the amount thereof. Payment of this invoice is guaranteed by the undersigned and does release the above insurance company from any and all claims as set forth on this invoice. Max draft payable to Autohaus Automotive, Inc. I agree to the subset of any work.

"If the work to be performed by Autohaus Automotive, Inc. has been requested through a new or used car dealer on behalf of a purchaser of the vehicle, and the car dealer received payment for said work, the car dealer agrees to hold said fund in trust for payment to Autohaus Automotive, Inc."

X

WE ARE NOT RESPONSIBLE FOR ENGINE INDUCED NOISES, I.E., ALTERNATOR AND ENGINE NOISE

ORIGINAL ESTIMATED PRICE \$

This estimate is based on our inspection and does not cover any additional parts and labor which may be required after the work has been opened up.

REVISED ESTIMATE \$

I acknowledge notice and oral approval of an increase in the original estimated price.

DATE CONTACTED	CONTACTED VIA	PRICED OK'D BY	NAME
TIME CONTACTED	PHONE PERSON	WHO CALLED FROM	DEalersHIP

RETURN PARTS TO CUSTOMER • WARRANTY PARTS NOT RETURNABLE TO CUSTOMER

CUSTOMER

234645



INVOICE WITH 20

AUTOHAUS, INC.  
AUTOHAUS AUTOMOTIVE, INC.  
2575 MONUMENT BLVD.  
CONCORD, CA. 94520-3101  
LIC. #E23799 LIC. #AD087154  
925-825-7111

NUMBER: 126992  
PAGE: 2  
DATE: 06/15/07  
TERMS: CASH

TERMS STRICTLY CASH UNLESS OTHER ARRANGEMENTS ARE MADE. A late charge at the rate of 1 1/2% per month or 18% per year will be charged on past-due accounts.

SOLD TO:

SHIP TO:

SAME  
TAMKIN, SANDRA  
4  
VALLEY HIGH  
LAFAYETTE, CA 94549

SALES ORDER NO	DATE SHIPPED	SHIPPED VIA	SLSM	SLSM
----------------	--------------	-------------	------	------

ORDERED	SHIPPED	BACK ORD.	ITEM NO.	DESCRIPTION	UNIT PRICE	UNIT	AMOUNT
074376	06/12/07		925-962-9414	NONE		684	684

VIN#: YS3AT75L3K7020477

*can  
fresh sm radio*

*806ZQ0M8*

SUBTOTAL: 1290.91  
TAX: 75.56  
TOTAL AMOUNT: 1366.47

PAYMENTS: VISA 1366.47

SPECIAL INSTRUCTIONS:

ALL PARTS NEW UNLESS OTHERWISE STATED.  
ELECTRICAL AND SPECIAL-ORDER PARTS ARE NON-RETURNABLE.  
WARRANTY AND RETURN REQUESTS MUST BE ACCOMPANIED BY RECEIPT.

MINIMUM CHARGE FOR DIAGNOSIS OF ANY AUTO AIR CONDITIONER IS OUR ADVERTISED MINIMUM, PLUS PARTS AND FREON.

WARRANTY NOTICE  
STATEMENT CONCERNING AMENDMENTS TO THE SONG-BEVERLY WARRANTY ACT AS FOLLOWS:

"A buyer of this product in California has the right to have this products serviced or repaired during the warranty period. The warranty period will be extended for the number of whole days that the product has been out of the buyer's hands for warranty repairs. If a defect exists within the warranty period, the warranty will not expire until the defect has been fixed. The warranty period will also be extended if the warranty repairs have not been performed due to delays caused by circumstances beyond the control of the buyer, or if the warranty repairs did not remedy the defect and the buyer notifies the manufacturer or seller of the failure of the repairs within 60 days after they were completed. If, after a reasonable number of attempts, the defect has not been fixed, the buyer may return this product for a replacement or a refund, subject in either case, to deduction of a reasonable charge for usage. This time extension does not affect the protections or remedies the buyer has under other laws."

An estimate where requested or required for labor and parts necessary for a specific job shall be given to the customer the service dealer in writing and the service dealer may not charge for work done or parts supplied in excess of estimate without prior consent of the customer. The service dealer may charge a reasonable fee for making the estimate.

I hereby authorized the above work to be done along with the necessary parts and materials. An express mechanic fee hereby acknowledged on the above car to secure the amount thereof. Payment of this invoice is guaranteed by undersigned and does release the above insurance company from any and all claims as set forth on this invoice. I draft payable to Autohaus Automotive, Inc. I agree to the subset of any work.

If the work to be performed by Autohaus Automotive, Inc. has been requested through a new or used car dealer on behalf of a purchaser of the vehicle, and the car dealer received payment for said work, the car dealer agrees to hold said bill in trust for payment to Autohaus Automotive, Inc."

*X [Signature]*  
WE ARE NOT RESPONSIBLE FOR ENGINE INDUCED NOISES, I.E., ALTERNATOR AND ENGINE NOISE

CUSTOMER

234646

Customer Invoice  
050522  
11/14/2006

**FIRESTONE COMPLETE AUTO CARE  
PLEASANT HILL  
570 CONTRA COSTA BLVD  
PLEASANT HILL, CA. 94523**

Service Advisor:  
05 OSAGYEFO  
925.686.0586

1982 SAAB 900 [RED]  
4-1985 2.0L SOHC  
Lic #: CARDINAL IA Vin #:  
In: 11/14/06 2:02PM Mileage: 1  
Out: 11/14/06 2:26PM

Store # 028347

RETAIL SALE

REG# AG222518, EPA# CAD98200178E

Description	Article Number	ID	Qty	Unit Price	Extended Price	Job Total
<b>BATTERIES</b>		05				<b>139.99</b>
MT26 INTERSTATE BATTERY	7098493	02TN	1	79.99	79.99	
REMOVE & REPLACE BATTERY	7042145	02NN	1	60.00	60.00	
<b>COURTESY CHECK</b>		05				
COURTESY CHECK	7046930	02NN	1	N/C	N/C	

Technician(s):  
02 DALE COOK

Payment History:

Visa	0438	146.59	47558B
Total Tendered		146.59	

Summary:

Parts	79.99
Labor	60.00
Shop Supplies	0.00
Sub-Total	139.99
Tax (8.25%)	6.60
<b>Total</b>	<b>\$146.59</b>

I have received the above goods and/or services. If this is a credit card purchase, I agree to pay and comply with my cardholder agreement with the issuer.

\_\_\_\_\_  
Customer Signature

**All parts are new unless otherwise specified.**

The experience you want.

**\$10 OFF YOUR NEXT PURCHASE OF \$25 OR MORE!**

- 1) Call 1-800-859-9203 or logon to [www.FirestoneCompleteAutoCare.com/Experience](http://www.FirestoneCompleteAutoCare.com/Experience); enter code 028347-050522;
- 2) Write redemption code here: \_\_\_\_\_ . Coupon expires 6 months from date of invoice, good at all participating locations. Must have valid redemption code. May not be combined with any other offer or to reduce existing debt. No copies accepted.

COMMITTED TO PROVIDING A POSITIVE CUSTOMER EXPERIENCE

See  reverse side for Warranty  Information

GOODYEAR AUTO SERVICE CENTER

A DIVISION OF THE GOODYEAR TIRE & RUBBER COMPANY
4119 23RD AVE
MOLINE, IL 61265
(309) 797-4124
FEDERAL TAX ID# 340253240



INVOICE
079237

09/27/02 09/27/02
12:56 PM 12:56 PM
TERR: 1434
NONSIG: 901434

PAGE: 01

BILL TO:

PHONE 1.
PHONE 2.
DATE REQUESTED 09/27/02
TIME REQUESTED
RETURN PARTS.. NO
SALESMAN..... 020 / 020
OTHER INFO.... PREPAY - BE IN TUESDAY (10-01-02)
VEH YEAR/MAKE. 89 SAAB
VEHICLE MODEL. 900 TURBO
VEHICLE COLOR.
LICENSE/STATE.
ODOMETR IN/OUT 20000 / 20000

ACCOUNT # COB TC CUST# TYPE/STATE AUTHORIZATION CREDIT CARD NO.
143400005 V 01 07182 0 IL 027378

Table with columns: SLSM, TECH, PRODUCT CODE, BC, QTY, DESCRIPTION, CORE, PARTS, LBR/EXCISE, LINE TOT. Contains 3 rows of item details.

COST IS CALCULATED ON THE HOURLY RATE OF 60.00 PER HOUR AND/OR A FLAT RATE OF \$

I UNDERSTAND THAT ALL CUSTOM WHEEL LUG NUTS MUST BE RE-TORQUED AFTER 25 MILES AND CHECKED PERIODICALLY.

IF YOU ARE NOT 100% SATISFIED, CALL
ALAN OPPENDIKE (signature)
THE STORE MANAGER, AT (309) 797-4124

CHARGED AMOUNT 309.66
STATE TIRE FEE 4.00
TAXABLE AMOUNT 255.76
PARTS TOTAL..... 255.
LABOR TOTAL..... 32.
SUB TOTAL..... 287.
SALES TAX..... 17.

X-----
CUSTOMER AUTHORIZATION FOR TOTAL

INVOICE TOTAL \$309.66

TREAD L/F..... 10/32 TREAD R/F..... 10/32 TREAD R/R..... 10/32 TREAD L/R.....

SEE REVERSE SIDE FOR IMPORTANT SAFETY
WARNING AND WARRANTY INFORMATION

conv  
 YEAR: 89 MAKE: 900 MODEL: CALDONAL LICENSE NUMBER: 953 AT 25143K 202 0477 SPEEDOMETER: 07876 TODAYS DATE: 6-24-98  
 DEL. DATE: VEHICLE I.D. NUMBER: 07876  
 TIME REC'D: 8:00 PROMISED: CWE PHONE WHEN READY: YES NO RES. PHONE #: 762-7716 BUS. PHONE #: WRITTEN BY: MAF ADD'L R.O. NO.:

"I hereby authorize the repair work herein set forth to be done (including parts and materials) and agree to make payment therefor in CASH, unless it is otherwise agreed and set forth in this order. I understand that as a matter of Iowa law you may retain possession of the vehicle until such cash payment is made. You are not responsible for any delays caused by unavailability of parts or delays in parts shipments nor for loss or damage to vehicle or any articles left in vehicle in case of fire, theft or any other cause beyond our control.  
 ANY WARRANTIES ON PRODUCTS SOLD ARE THOSE MADE BY THE MANUFACTURER. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESSED OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE AND THIS COMPANY NEITHER ASSUMES NOR AUTHORIZES ANY PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCT OR SERVICE."  
 SIGNATURE: [Signature]

ESTIMATE  
 YOU HAVE THE RIGHT TO A WRITTEN OR ORAL ESTIMATE IF THE EXPECTED COST OF REPAIRS OR SERVICE WILL BE MORE THAN FIFTY DOLLARS. YOUR BILL WILL NOT BE HIGHER THAN THE ESTIMATE BY MORE THAN TEN PERCENT UNLESS YOU APPROVE A HIGHER ESTIMATE BEFORE REPAIRS ARE FINISHED. INITIAL YOUR CHOICE  
 SAVE OLD PARTS  
 YES  NO  
 Written estimate  No estimate  
 Oral estimate  Call me if repairs and service will be more than \$

**W CODE RELATING TO LABOR INSTRUCTIONS**

QTY	PART NO	DESCRIPTION	AMOUNT
1	5919 336	GLASS	29000
2	6953 906	Ram	53000

OPERATION NO.	T.C.	REPAIR ORDER - LABOR INSTRUCTIONS	AMOUNT
A	6	TOP moves VERY slow Diagnosed and Replaced Both leaking Rams	20136
B	6	R.R. window is Inop AT times cleaned switch contacts	N/C
C	6	L.F. window BROKE when 5034 Door WAS closed w/ window DOWN - Replaced GLASS	
D	6	STALLS AT STOPS AT times N/C no Problem Found AT this time	

PAID CHECK  
 7-3-98

<b>TOTAL</b>		92000
SUBLET REPAIRS	P.O. #	
<b>TOTAL SUBLET</b>		
GALS. GAS @		
QTS. OIL @		
LBS. GREASE @		

WE RECOMMEND THE FOLLOWING REPAIRS

**MERCURY LINCOLN SAAB**

**STRIETER MOTOR COMPANY**  
 OVER 75 YEARS  
 520 W. Kimberly Rd. Phone 391-1500

**ALWAYS BRING YOUR CAR HERE FOR FACTORY AUTHORIZED SERVICE**

... Compare Service, Too!  
 We guarantee our service work for 12 mo. or 12,000 miles, whichever comes first. If our repair or replacement fails in normal service within that period, we'll fix it free of charge. Parts and Labor.  
 We give you a report card... You give us a grade.  
 Our goal: "No unhappy owners."

DESCRIPTION	AMOUNT
LABOR	25170
PARTS	92000
SUBLET REPAIRS	
GAS, OIL & GREASE	
SHOP SUPPLIES	
HAZARDOUS WASTE	
WARRANTY DEDUCTIBLE	
<b>SUB-TOTAL</b>	<b>117170</b>
TAX	7030
<b>CHARGE SALE</b>	
<b>CASH SALE</b>	<b>124200</b>

PRINTED IN U.S.A. 0K 0251

YEAR MAKE MODEL LICENSE NUMBER DEL. DATE VEHICLE I.D. NUMBER 8735 5-3-93

89 1900 ISU0481  
 I hereby authorize the repair work herein set forth to be done (including parts and materials) and agree to make payment therefor in CASH, unless it is otherwise agreed and so set forth in this order. I understand that as a matter of Iowa law you may retain possession of the vehicle until such cash payment is made. You are not responsible for any delays caused by unavailability of parts or delays in parts shipments nor for loss or damage to vehicle or any articles left in vehicle in case of fire, theft or any other cause beyond our control.  
 ANY WARRANTIES ON PRODUCTS SOLD ARE THOSE MADE BY THE MANUFACTURER. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESSED OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE AND THIS COMPANY NEITHER ASSUMES NOR AUTHORIZES ANY PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCT OR SERVICE.

SIGNED: Sean Stephenson  
 ESTIMATE  
 YOU HAVE THE RIGHT TO A WRITTEN OR ORAL ESTIMATE IF THE EXPECTED COST OF REPAIRS OR SERVICE WILL BE MORE THAN FIFTY DOLLARS. YOUR BILL WILL NOT BE HIGHER THAN THE ESTIMATE BY MORE THAN TEN PERCENT UNLESS YOU APPROVE A HIGHER ESTIMATE BEFORE REPAIRS ARE FINISHED. INITIAL YOUR CHOICE:  
 Written estimate  No estimate   
 Oral estimate  Call me if repairs and service will be more than \$

TIME REC'D PROMISED PHONE WHEN READY RES. PHONE # BUS. PHONE # WRITTEN BY ADD'L R.O. NO.  
 YES NO 762-7716 359-7092 P  
 P.O. NUMBER  
 NAME \_\_\_\_\_  
 ADDRESS \_\_\_\_\_  
 CITY Alwan STATE \_\_\_\_\_ ZIP \_\_\_\_\_

PRELIMINARY EST. \$ \_\_\_\_\_ This estimate is based on our initial inspection and does not cover any additional parts and labor which may be required after disassembly and inspection. REVISED ESTIMATE \$ \_\_\_\_\_  
 CAR SAVERS AMOUNT  
 LUBE   
 OIL CHANGE   
 CHANGE OIL FILTER QART   
 7500 ML. SERVICE   
 WASH

KEY CODE RELATING TO LABOR INSTRUCTIONS

QTY.	PART NO.	DESCRIPTION	AMOUNT
1	0271262	Battery	96.60
1	oil ME		4.95

OPERATION NO.	T.C.	REPAIR ORDER - LABOR INSTRUCTIONS	AMOUNT
A		Degrease front end oil P/E Check your Oil Leak L. FRT OF Eng WASH	MC
B		Adj Headlights to high	8.00
C		Replace Battery	13.00
D			

**PAID**

TOTAL

SUBLET REPAIRS	P.O. #
TOTAL SUBLET	
GALS. GAS @	
QTS. OIL @	
LBS. GREASE @	

WE RECOMMEND THE FOLLOWING REPAIRS

**MERCURY LINCOLN SAAB**  
**STRIETER MOTOR COMPANY**  
 OVER 60 YEARS  
 520 W. Kimberly Rd. Phone 391-1500

**ALWAYS BRING YOUR CAR HERE FOR FACTORY AUTHORIZED SERVICE**

... Compare Service, Too!  
 We guarantee our service work for 12 mo. or 12,000 miles, whichever comes first. If our repair or replacement fails in normal service within that period, we'll fix it free of charge. Parts and Labor.  
 We give you a report card. You give us a grade. Our goal: "No unhappy owners."

DESCRIPTION	AMOUNT
LABOR	70.00
PARTS	109.55
SUBLET REPAIRS	
GAS, OIL & GREASE	
SHOP SUPPLIES	
WARRANTY DEDUCTIBLE	
SUB-TOTAL	183.55
TAX	7.41
CHARGE SALE	130.96
CASH SALE	

THANK YOU





84754

# RAPID LUBE & OIL

15 MINUTE OIL CHANGE  
YOUR AUTOMOTIVE FLUID  
MAINTENANCE AND TUNE-UP SPECIALISTS  
18th & STATE ST., BETTENDORF

359-4518  
MON. - FRI. 8-6 SAT. 8-4

PD. Cash



PARTS		PLEASE PRINT	DATE		CASH	CHECK	MIG	USP	VEHICLE IDENTIFICATION NUMBER
				11-17-90					
LABOR		YEAR	MAKE	MODEL	LICENSE	STATE	MILEAGE		
		89	SAAB	900	ISU0481	Ia	4465		
MECH	SERVICES	AMOUNT	FLUID LEVELS	OK	MECH	PART NUMBER		AMOUNT	
	Transmission Fluid & Filter Change <small>(recommended every 30,000 miles)</small>		MASTER CYLINDER	✓	OIL	①	Turbo 10w30	19	95
	Radiator Flush <small>(recommended every 2 years)</small>		POWER STEERING	✓	OIL FILTER		200 Bus. Card		
	Tire Rotation <input type="checkbox"/> Balancing <input type="checkbox"/> <small>(recommended every 30,000 miles)</small>		BATTERY	✓	AIR FILTER	OK			
	Tune Up <small>(excursion recommended every 2 years)</small>		RADIATOR - 35	✓	BREATHER ELEMENT				
	Air Conditioning - recharge/evacuate <small>(recommend checking owners manual)</small>		TRANSMISSION	✓	WIPER BLADES	OK			
	Differential/Manual Trans. Fluid Change <small>(recommended every 30,000 miles)</small>		REAR/FRONT END	✓	TREAD DEPTH				
	Fuel Injection Cleaning <small>(recommend changing every 4 years)</small>		CLUTCH FLUID			9/32	10/32		
	Hoses		WASHER FLUID	✓		10/32	10/32		

ESTIMATE  
YOU HAVE THE RIGHT TO A WRITTEN OR ORAL ESTIMATE IF THE EXPECTED COST OF REPAIRS OR SERVICE WILL BE MORE THAN FIFTY DOLLARS. YOUR BILL WILL NOT BE HIGHER THAN THE ESTIMATE BY MORE THAN TEN PERCENT UNLESS YOU APPROVE A HIGHER ESTIMATE BEFORE REPAIRS ARE FINISHED. INITIAL YOUR CHOICE:

\_\_\_\_ Written estimate    \_\_\_\_ No estimate     NO  
\_\_\_\_ Oral estimate    Call me if repairs and Service will be more than \$ \_\_\_\_     YES

SAVE OLD PARTS

TRANSFER TO RIGHT

ORIGINAL ESTIMATE	REVISED ESTIMATE	OK'D BY	DATE
\$	\$		

**CUSTOMER POLICY:**  
At Rapid Lube and Oil, we sincerely believe that our customers are the most important aspect of our business. In reality, they are the reason for our existence. Because of this we have always and will continue to strive for excellence in regards to our service. We welcome any comments or ideas you may have. **THANK YOU for your patronage.**

I hereby authorize the repair work hereinafter set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection.

### DISCLAIMER OF WARRANTIES

It is understood and agreed by the undersigned purchaser that the product described hereon is sold by the dealer "AS IS" and that dealer makes no warranty of merchantability of the product and makes no warranty that such product is fit for any particular purpose and that any express written warranty relating to the product is a contract solely between the factory and the purchaser. The undersigned understands and agrees that there is no guarantee that the work done under this repair order will put the vehicle in good and proper working condition for the reason that the owner chose not to authorize other repairs necessary to place the vehicle in a safe condition and proper working order."

- DOOR STICKER
- COMPUTER

SUB TOTAL	19 95
TAX	1 00
<b>TOTAL</b>	<b>20 95</b>

**IMPORTANT: Safety Service Recommendations:**

DATE BORN

CUSTOMER SIGNATURE

50 MONTH

No. 25264

**SAAB MAINTENANCE FREE BATTERY**

WARRANTY AND REGISTRATION CARD  
(To be filled out by Saab Dealer at time of sale)

Owner's Name

Address

Date of Sale

VIN No.

Selling Dir. No.

LIMITED WARRANTY

Saab-Scania of America, Inc., Saab Drive, Orange, Connecticut 06477, warrants to the original retail Customer purchaser only of a genuine Saab Maintenance-Free battery purchased from an authorized Saab dealer that when installed in a vehicle it will be free from defects in material and workmanship for a period of fifty (50) months commencing from the date of original installation, as long as it remains in the vehicle in which it was originally installed.

If any genuine Saab Maintenance-Free battery covered by this warranty is determined to be defective in material or workmanship and fails to hold a charge, any authorized Saab dealer will replace it during the first year of use, part only, with a new Saab battery of the same type upon its return and presentation of the warranty registration card. After one year the purchaser will be required to pay only a parts amount pro-rated at the rate of two percent (2%) of the current selling price for each month or part of a month following original installation. Labor costs are not covered in either case. THIS REMEDY IS THE SOLE AND EXCLUSIVE REMEDY AVAILABLE UNDER THIS WARRANTY AND ALL OTHER REMEDIES ARE HEREBY SPECIFICALLY EXCLUDED.

THIS WARRANTY DOES NOT COVER:

1. Failures resulting from misuse, commercial use, negligence, accident, damage or competition.
2. INCIDENTAL AND CONSEQUENTIAL DAMAGES TO THE EXTENT ALLOWED BY LAW (RESULTING FROM A DEFECT COVERED BY THIS WARRANTY OR BY ANY APPLICABLE IMPLIED WARRANTY) INCLUDING, BUT NOT LIMITED TO, LOSS OF USE OF THE VEHICLE, LOSS OF TIME, INCONVENIENCE AND COMMERCIAL LOSS.

THIS WARRANTY IS THE ONLY WARRANTY APPLICABLE TO GENUINE SAAB MAINTENANCE-FREE BATTERIES EXCEPT FOR ANY WARRANTIES OTHERWISE IMPLIED BY LAW. SUCH IMPLIED WARRANTIES ARE, HOWEVER, ALSO LIMITED TO THE DURATION OF THIS WRITTEN WARRANTY. NEITHER SAAB-SCANIA AB, SAAB-SCANIA OF AMERICA, INC. NOR FRANCHISED SAAB DEALERS, INDIVIDUALLY OR COLLECTIVELY, ASSUME OR AUTHORIZE ANYONE TO ASSUME FOR ANY OR ALL OF THEM OBLIGATION OR RESPONSIBILITY TO EITHER THE PURCHASER OF A GENUINE SAAB MAINTENANCE-FREE BATTERY OR TO ANY OTHER PERSON WITH RESPECT TO THE CONDITION OF SUCH BATTERY OTHER THAN AS EXPRESSLY ASSUMED IN THIS WARRANTY.

Please Note:

Some states do not allow limitations on how long an implied warranty lasts, and/or the exclusion or limitation of incidental or consequential damages, so the above limitations and exclusions may not apply to you. Moreover, this warranty gives you specific legal rights, and you may also have other rights which vary from state to state.

SAVE THIS WARRANTY CARD AS PROOF OF PURCHASE



VIN	YR.	MODEL	COLOR	INVOICE DATE	KEY NO.	REG.	DIST.	DLR. CODE
Y53AT75L3K7020477	89	952M	CHERRY	05/22/89	AC1582	40	43	1804

VIN: K7020477 ORDER DATE: 04-17-89

OWNER INFORMATION

PRIMARY OR COMPANY/LEASE DRIVER

TITLE CODES	
1.	COMPANY CAR
2.	LEASE CAR
3.	MR.
4.	MRS.
5.	MS.
6.	MISS
7.	MR. & MRS.

TITLE CODE: \_\_\_\_\_  
 NAME: \_\_\_\_\_  
 STREET: \_\_\_\_\_  
 CITY: \_\_\_\_\_  
 STATE: \_\_\_\_\_  
 ZIP: \_\_\_\_\_  
 BUS/HOME: \_\_\_\_\_

TITLE CODE: \_\_\_\_\_  
 NAME: \_\_\_\_\_  
 STREET: \_\_\_\_\_  
 CITY: \_\_\_\_\_  
 STATE: \_\_\_\_\_  
 ZIP: \_\_\_\_\_  
 BUS/HOME: \_\_\_\_\_ PHONE: \_\_\_\_\_

DEALERSHIP INFORMATION

DEALER NAME: Strieter Motor Company  
 DELIVERY DATE: 05-27-89  
 SALES PERSON: Lowell Stuedemann  
 SALES MANAGER: Lowell Stuedemann

**WE'RE DEDICATED TO SAFETY**



**PLEASE BUCKLE UP!**

EXTENDED SERVICE CONTRACT	TRADE IN INFORMATION:	MAKE	MODEL	YEAR	MILEAGE
SAAB <input type="checkbox"/> OTHER <input type="checkbox"/>					

VIN	YR.	MODEL	COLOR	INVOICE DATE	KEY NO.	REG.	DIST.	DLR. CODE
Y53AT75L3K7020477	89	952M	CHERRY	05/22/89	AC1582	40	43	1804

**PRE-DELIVERY PROCEDURES COMPLETED**

All applicable inspections and services have been performed as outlined on the reverse side of this page and on the PDI checklist coupon in the Warranty/Service Record Booklet. Vehicle has been road tested and a final clean up and inspection performed. The car is fueled and ready for delivery.

*John Horden*  
SERVICE MANAGER

**PRESENTATION AND DEMONSTRATION OF NEW CAR FEATURES**

- Verify customer's receipt and review of Pre-Delivery Information Packet
- Operation of central locking system  Alarm system (if equipped)  Child proof locks-4 Dr.  Hood release
- Underhood-Location of engine oil dipstick, filler cap  Engine coolant, windshield/washer reservoir, brake fluid, transmission dipstick  Fuse box (extra fuses), bulb replacement  Underhood lamp (9000)
- Location of gas filler cap, emergency filler release (9000)  Trunk release  Spare, jack, handle (Indicate jack points)
- Tool Kit  Location of sunroof emergency crank (900 Turbo & SPG)  Trunk light switch
- Seat adjustments, fold down rear seats, seat belt operation/adjustment  Review airbag system (9000, if equipped)
- Review operation of ignition key, driving controls, instruments and warning lights  Explain use of Cruise Control  Fog light switch
- Information display (9000)  Heated seats  Climate control  Interior lights  Emergency sunroof crank (9000)  Fuse box (9000)
- Operation/removal of sound system  Accessories  Operation of convertible top
- TURBOCHARGED ENGINE: Warm up/cool down procedure  MANUAL TRANSMISSION: Shift up indicator & reverse gear engagement

**PRESENTATION AND EXPLANATION OF NEW CAR DOCUMENTS**

- Present Document Organizer. Review with owner appropriate manuals, warranties, and applicable accessory information. Insert emission performance warranty dealer certification statement, as well as sales representative and service manager's business card.
- Warranty/Service Record Booklet, check that PDI coupon has been removed and PDI record stub has been stamped in the service record section. Emphasize I.D. page, noting VIN, delivery date and new car warranty expiration.
- Importance of recommended maintenance schedules and proper use of service record. Emphasize break-in service (free except fluids and oil filter if performed between 800 - 1500 miles).
- Terms of applicable warranties: new car, emission controls, tires (manufacturer's warranty), perforation and parts/accessories.
- Thoroughly explain and offer Saab Extended Service Contract.

**INTRODUCTION OF RESPONSIBLE DEALER PERSONNEL**

SERVICE MANAGER  PARTS MANAGER  DEALER PRINCIPAL/GENERAL MANAGER

The owner of this new Saab has been briefed on the items listed above and advised of our service department business hours and whom to contact for an appointment for maintenance and service requirements.

*Lowell Stuedemann*  
DEALER SALES REPRESENTATIVE

*[Signature]*  
CUSTOMER



I have received my new Saab in accordance with the dealer's Dedicated Delivery.

**CUSTOMER COPY #3 GIVE TO CUSTOMER**



# SAAB

## 900 — INSTALLATION INSTRUCTIONS (Equipped with passive restraints)

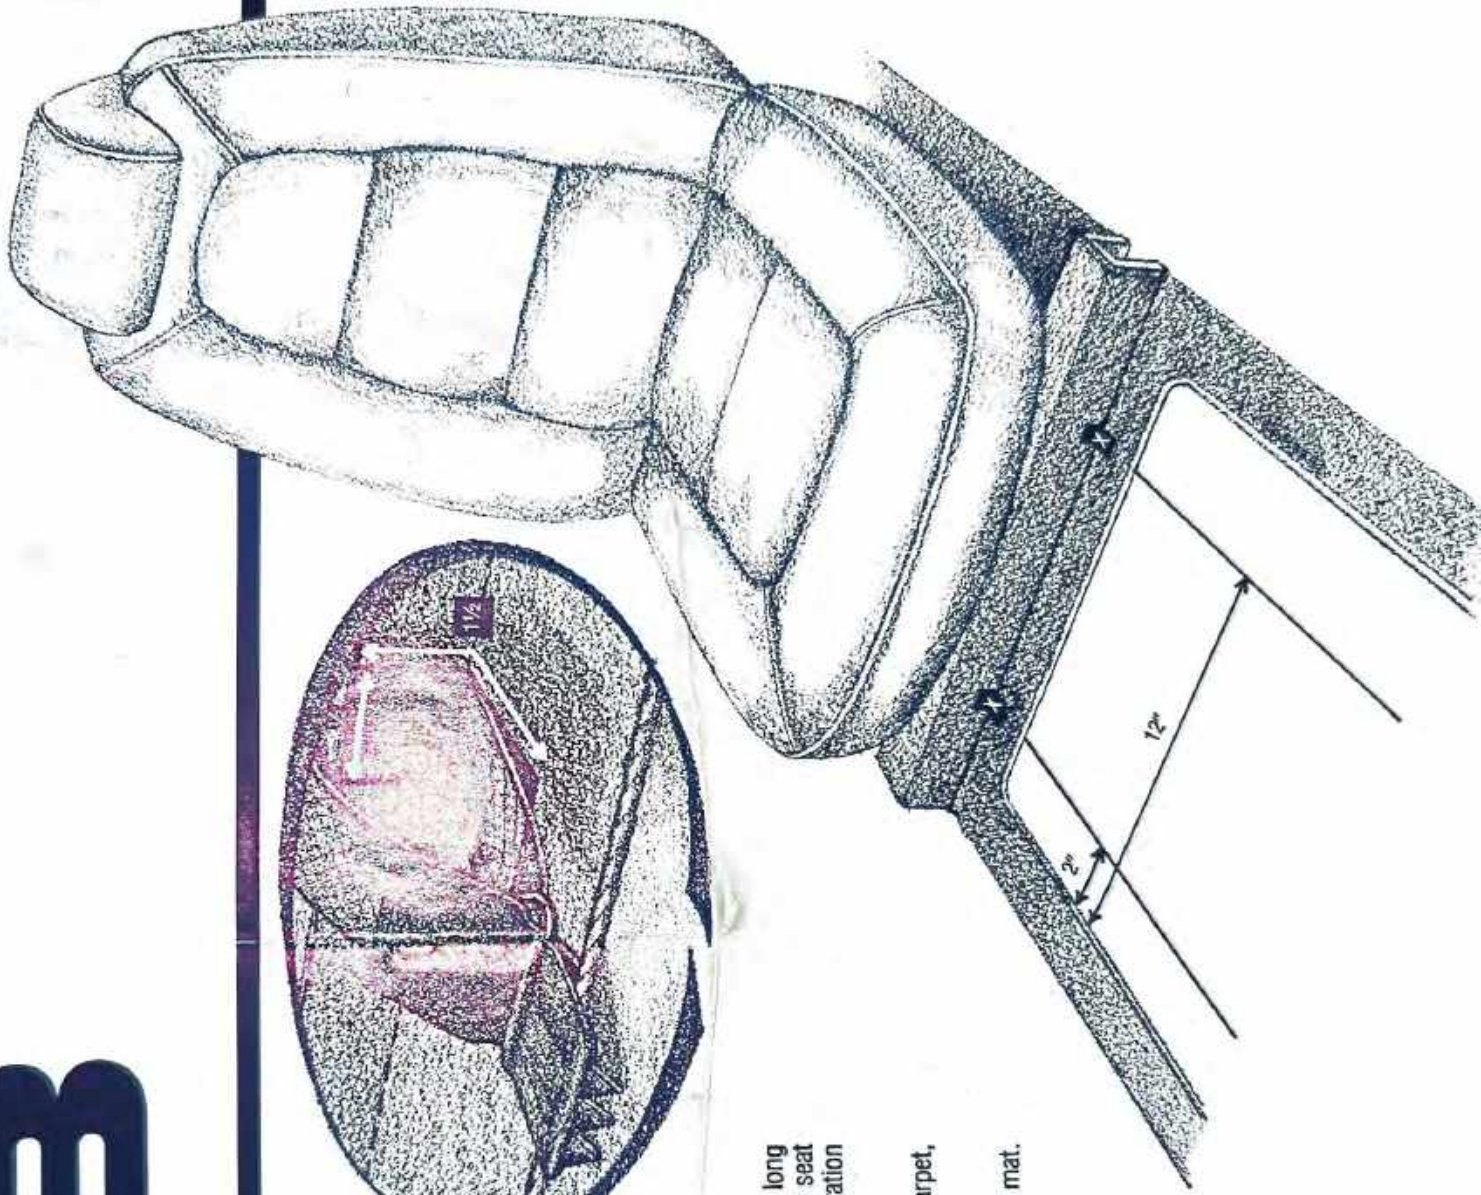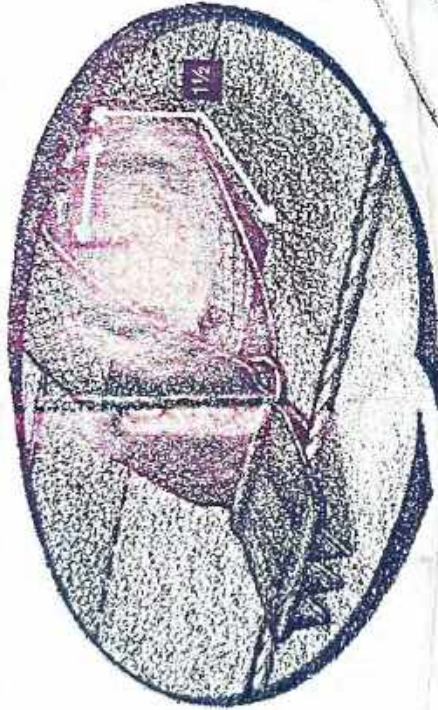

1. Using a razor blade or a sharp knife, make two  $1\frac{1}{2}$ " long strips from the rear carpet where the floor pan meets the driver's seat support beam in the positions marked with an "X" in the illustration below. Be careful not to cut any wires.
2. Pass the Mat-Loc® strap end through the openings in the carpet, around the beam, and through the buckle. Tighten securely.
3. Open the Mat-Loc clip and attach to the rear edge of the floor mat. Close clip tightly.



Saab-Scania of America, Inc.

Authorized Dealer  
STRYTER MOTOR CO.

520 WEST KIMBERLY ROAD  
DAVENPORT, IOWA

52806

Make & Model  
1989 SAAB 900 TURBO CONV/952M

Color  
CHERRY RED L.D. 542854

Vehicle ID No.  
YS3AT75L3K7020477

Standard Equipment

4 CYL 16 VALVE DOHC TURBO ENGINE  
APC CHARGE PRESSURE CONTROL SYSTEM  
CHARGE AIR INTERCOOLER  
ELECTRONIC FUEL INJECTION SYSTEM  
ELECTRONIC IGNITION, HALL EFFECT  
RACK/PINION POWER ASSIST STEERING  
4 WHEEL POWER ASSIST DISC BRAKES  
TINTED GLASS, ALL AROUND  
ELECTRIC REAR WINDOW DEMISTER  
UNDERCOAT/ANTI-CORROSION TREATMENT  
UPPER BODY SIDE MOLDING  
DUAL POWER MIRRORS, HEATED  
1.85/65 H-RATED STEEL BELT RADIALS  
GAS/HYDRAULIC SHOCK ABSORBERS  
FRONT/REAR STABILIZER BARS  
LIGHT ALLOY WHEELS  
POWER TOP WITH FULL HEADLINER  
ELECTRIC WINDOWS, FRONT/REAR  
TIME DELAY COURTESY LIGHTS  
FRONT/REAR SPOILERS

5 SPEED MANUAL TRANSMISSION  
HALOGEN REPLACEABLE BULB HEADLAMPS  
LIGHTS, CORNERING/SIDE REVERSING  
FRONT FOG LIGHTS  
TACHOMETER/QUARTZ ANALOG CLOCK  
DRIVER SEAT HEIGHT/TILT ADJUST  
RECLINING, HEATED FRONT SEATS  
REAR SEAT HEADRESTS  
LEATHER SEATING SURFACES  
LEATHER WRAPPED STEERING WHEEL  
CENTRAL LOCK SYSTEM, DOORS/TRUNK  
AIR CONDITIONING  
ELECTRONIC CRUISE CONTROL  
TIME DELAY COURTESY LIGHTS  
CENTER CONSOLE, FRONT  
THEFT ALARM  
80W ELECTRONIC AM/FM STEREO/CASS  
7 BAND EQUALIZER  
4 SPEAKER SOUND SYSTEM  
AUTOMATIC ELECTRIC ANTENNA

The above information is affixed pursuant to Federal Automobile Information Disclosure Act. Importer's suggested retail price does not include gasoline, license and title fees and state and local taxes. Dealer installed options and accessories are not included. Where transportation charge is not shown, this has been paid by dealer directly to transporter.  
Saab-Scania of America, Inc. is the sole factory authorized importer of this vehicle and is a subsidiary of the manufacturer-Saab Car Division, Nykoping Sweden

Compare this vehicle to others in the FREE GAS MILEAGE GUIDE available at the dealer

CITY MPG

00000 00000  
0 0  
00000 00000  
0 0  
00000 00000

Actual Mileage will vary with options, driving conditions, driving habits and vehicle's condition. Results reported to EPA indicate that the majority of vehicles with these estimates will achieve between

18 and 26 mpg in the city and between 23 and 33 mpg on the highway.



1989 SAAB 900, 2.0L ENGINE, 16-VALVE 4-CYLINDER, TURBOCHARGER, 3-WAY CATALYST, FEEDBACK FUEL SYSTEM, 5-SPEED MANUAL TRANSMISSION

Estimated Annual Fuel Cost:  
\$594

HIGHWAY MPG

00000 00000  
0 0 0  
00000 00000  
0 0 0  
00000 00000

For Comparison Shopping, all vehicles classified as SUBCOMPACT have been issued mileage ratings ranging from

11 to 58 mpg highway  
18 to 53 mpg city and 11 to 58 mpg highway

Importer's Suggested Port-of-Entry Price:

Options and Additional Charges

Part Of Importation BRUN, GA	KYUSHU MARU	32,095.00
Delivered By TRUCK		
<b>Importer's Suggested Port-of-Entry Price:</b> Options and Additional Charges		
DESTINATION CHARGE		359.00
DEALER PREPARATION (PRE-DELIVERY INSPECTION SERVICE)		INCL IN PRICE
3 YEAR/36,000 MILE LIMITED VEHICLE WARRANTY		INCL IN PRICE
6 YEAR PERFORMANCE WARRANTY		INCL IN PRICE
<i>5421</i>		
<b>Total Suggested Retail Price</b>		<b>32,454.00</b>

We are Dedicated to Your Safety

Seat Belts  
Save Lives...



Buckle Up

**Invoice No.**  
**000035484**

**Page 1**  
**Order Date 06/21/22 08:36 am**  
**Completed: 07/08/22 02:42 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**89 Saab 900 Conv't red**  
43817 Mi.Last in 4/9/2022  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Eq:

**Job01 Misc. repairs** **Labor: \$67.50**

[1] Replace antenna mast -pre-paid. [2] General inspection. Add 1 quart oil. [3] Clean and detail. Leather care on seats.

5W40	Castrol Edge synthetic-S	1.0 @	9.99 =	9.99	9.99
					<b>Job Subtotal: \$77.49</b>

Recommendations: \*Lube, Oil and Filter\*

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

<b>Labor</b>	<b>67.50</b>
<b>Parts</b>	<b>9.99</b>
<b>Enviromental</b>	<b>1.35</b>
<b>Shop Supplies</b>	<b>4.05</b>
<b>Tax</b>	<b>1.05</b>
<b>Total</b>	<b>\$83.94</b>
<b>Payments</b>	<b>0.00</b>
<b>Bal Due</b>	<b>83.94</b>

Thank you for choosing Foreign Affairs



**Invoice No.**  
**000035484**

**Page 1**  
**Order Date 06/21/22 08:36 am**  
**Completed: 07/08/22 02:42 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

<b>Wert, Joshua</b> 2221 Dwight Lane Minnetonka MN 55305  Joshua: 612-965-4040 Randi Levine: 612-803-4000	<b>89 Saab 900 Conv't red</b> 43817 Mi.Last in 4/9/2022 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Eq:
--	---

**Job01 Misc. repairs** **Labor: \$67.50**

[1] Replace antenna mast -pre-paid. [2] General inspection. Add 1 quart oil. [3] Clean and detail. Leather care on seats.

5W40	Castrol Edge synthetic-S	1.0 @	9.99 =\$	9.99	9.99
					<b>Job Subtotal: \$77.49</b>

Recommendations: \*Lube, Oil and Filter\*

<b>Payments to Foreign Affairs</b>	<b>Cost Summary</b>
------------------------------------	---------------------

<b>Status: Completed Work Order</b>	<b>Labor</b>	<b>67.50</b>
	<b>Parts</b>	<b>9.99</b>
	<b>Enviromental</b>	<b>1.35</b>
	<b>Shop Supplies</b>	<b>4.05</b>
	<b>Tax</b>	<b>1.05</b>
	<b>Total</b>	<b>\$83.94</b>
<b>Payments:</b>	<b>Payments</b>	<b>0.00</b>
	<b>Bal Due</b>	<b>83.94</b>

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000035332**

**Page 1**  
**Order Date 04/09/22 11:31 am**  
**Completed: 04/12/22 05:46 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

<b>Wert, Joshua</b> 2221 Dwight Lane Minnetonka MN 55305  Joshua: 612-965-4040 Randi Levine: 612-803-4000	<b>86 Alfa Romeo GTV-6 red</b> 50600 Mi.Last in 7/31/2021 Lic: OMO398/ON 6Cyl 2.5 Eng Vin: ZARRAA669XG1008014 01/86 Eq:
--	---

**Job01 Spring service** **Labor: \$135.00**

Battery dead. Pick up at customer's storage. Jump start and run to shop. Charge battery on smart charger overnite. Check fluids and tire pressures. All OK. Wash and vacuum.

**Job Subtotal: \$135.00**

**Recommendations: \*Lube, Oil and Filter\***

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	135.00
Parts	0.00
Enviromental	2.70
Shop Supplies	8.10
Tax	0.61
Total	\$146.41
Payments	0.00
Bal Due	146.41

Thank you for choosing Foreign Affairs



**Invoice No.**  
**000035331**

**Page 2**  
**Order Date 04/09/22 11:31 am**  
**Completed: 04/22/22 05:32 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**Recommendations: \*Lube, Oil and Filter\***

**Payments to Foreign Affairs**

**Status: Completed Work Order**

**Payments:**

**Cost Summary**

<b>Labor</b>	<b>997.50</b>
<b>Parts</b>	<b>680.06</b>
<b>Sublet</b>	<b>99.95</b>
<b>Enviromental</b>	<b>19.95</b>
<b>Shop Supplies</b>	<b>28.00</b>
<b>Tax</b>	<b>53.28</b>
<b>Total</b>	<b>\$1878.74</b>
<b>Payments</b>	<b>0.00</b>
<b>Bal Due</b>	<b>1878.74</b>

**Thank you for choosing Foreign Affairs**

Invoice No.  
**000034748**

**Page 1**  
Order Date 06/11/21 11:54 am  
Completed: 06/14/21 12:40 pm

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

<b>Wert, Joshua</b> 2221 Dwight Lane Minnetonka MN 55305  Joshua: 612-965-4040 Randi Levine: 612-803-4000	<b>89 Saab 900 Conv't red</b> 41228 Mi. Last in 8/7/2020 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Eq:
--	--

**Job01 Repair right window** **Labor: \$250.00**

Right window won't go up. Remove door trim panel to inspect. Can close window with direct power to motor. Trace lack of power to faulty RF window switch. Replace window switch and re-install door trim panel. Also reinstall missing screw in LF door trim panel

95 01 859	RF window switch-S	1.0 @	33.05 =\$	33.05	33.05
					<b>Job Subtotal: \$283.05</b>

**Job02 Repair loose shifter** **Labor: \$375.00**

Shift lever is loose. Remove console for access. Found shifter housing had come loose due to loose/missing housing bolts that are difficult to tighten due to their design. Replace missing fasteners with standard bolts that should hold better.

**Job Subtotal: \$375.00**

Recommendations: \*Lube, Oil and Filter\*

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	625.00
Parts	33.05
Enviromental	12.50
Shop Supplies	28.00
Tax	4.60
Total	\$703.15
Payments	0.00
Bal Due	703.15

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000034127**

**Page 1**  
**Order Date 08/07/20 05:26 pm**  
**Completed: 08/13/20 02:38 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

<b>Wert, Joshua</b> 2221 Dwight Lane Minnetonka MN 55305  Joshua: 612-965-4040 Randi Levine: 612-803-4000	<b>89 Saab 900 Conv` t red</b> 40300 Mi.Last in 7/18/2020 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Eq:
--	---

repair dash trim, general inspect

**Job01 Repair dash trim** **Labor: \$100.00**

**Job Subtotal: \$100.00**

**Job02 Lube, Oil & Filter** **Labor: \$37.50**

Drain oil and refill with Castrol Edge synthetic 5W40 oil. Replace oil filter.

72161WS	oil filter-S	1.0 @	8.90 = \$	8.90	
5W40	Castrol Rdge synthetic-S	5.0 @	9.99 = \$	49.95	58.85
					<b>Job Subtotal: \$96.35</b>

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

<b>Labor</b>	<b>137.50</b>
<b>Parts</b>	<b>58.85</b>
<b>Enviromental</b>	<b>2.75</b>
<b>Shop Supplies</b>	<b>8.25</b>
<b>Tax</b>	<b>5.05</b>
<b>Total</b>	<b>\$212.40</b>
<b>Payments</b>	<b>0.00</b>
<b>Bal Due</b>	<b>212.40</b>

**Thank you for choosing Foreign Affairs**

**Invoice No.**  
**000034079**

**Page 1**  
**Order Date 07/18/20 10:34 am**  
**Completed: 07/24/20 02:00 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

<b>Wert, Joshua</b> 2221 Dwight Lane Minnetonka MN 55305  Joshua: 612-965-4040 Randi Levine: 612-803-4000	<b>89 Saab 900 Conv't red</b> 40253 Mi. Last in 10/3/2019 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Eq:
--	---

overheat, lost coolant

**Job01 Diagnose overheating** **Labor: \$150.00**

Car towed in due to overheated, lost coolant. Coolant on ground by driver front wheel. Inspect for cause. No visible signs of leaks. Pressure test system. Cooling system does not leak during pressure test. Run engine and observe. Auxiliary fan does not run with either AC or engine heat. Engine begins to overheat when aux. fan fails to come on. Test wiring to find reason for no aux. fan. Fan runs when powered directly. Bypass time delay relay to eliminate relay as cause. Jumper fan temperature switch and fan runs. Needs aux fan temperature sender replaced.

**Job Subtotal: \$150.00**

**Job02 Replace cooling fan switch** **Labor: \$125.00**

Per Saab TSB rewire to delete time delay relay for cooling fan. Replace cooling fan switch. Top up coolant.

40 86 708	aux. fan switch-S	1.0 @	64.94 =\$	64.94	
NPN	coolant-S	1.0 @	23.50 =\$	23.50	88.44

**Job Subtotal: \$213.44**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	275.00
Parts	88.44
Environmental	5.50
Shop Supplies	16.50
Tax	7.90
Total	\$393.34
Payments	0.00
Bal Due	393.34

Thank you for choosing Foreign Affairs





**Invoice No.**  
**000033521**

**Page 2**  
**Order Date 10/03/19 08:44 am**  
**Completed: 10/09/19 11:48 am**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**Job06 Repair lighting wiring**

for tail lights. After TSB performed signals work correctly.

**Job Subtotal: \$118.00**

**Job07 Misc.**

**Labor: \$0.00**

1] LF signal lamp loose at headlight. Light has broken mount tab on lamp and broken mount tab on headlight housing for signal mount. Able to secure lamp, but needs both parts replaced for full repair. 2] Clean and detail complete.

**Job Subtotal: \$0.00**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	861.40
Parts	211.01
Sublet	134.00
Enviromental	17.23
Shop Supplies	28.00
Tax	17.99
Total	\$1269.63
Payments	0.00
Bal Due	1269.63

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000033484**

**Page 1**  
**Order Date 09/18/19 10:14 am**  
**Completed: 09/28/19 12:02 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

<b>Wert, Joshua</b> 2221 Dwight Lane Minnetonka MN 55305  Hm: Work Phone: 612-965-4040 c	<b>89 Saab 900 Conv` t red</b> 38400 Mi.Last in 7/27/2019 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Eq:
---	---

**Job01 Repair window switches** **Labor: \$177.00**

RR window switch pushed down out of housing. Remove window switches. At last repair, needed to glue in some switches. Now switch assembly housing is compromised. Obtain 3 new window switches and used housing with 4 switches. Mix and match new switches with replacement housing and used switch buttons. Now all window switches are clipped into position [not glued]. All 4 switches are new switches. All 4 switches light up, but color of bulbs varies. Rear switch buttons are smooth, front buttons have ridge on button. Work order mileage is approximate.

NPN-USED	switch housing assl'y-S	1.0 @	70.00 =\$	70.00	
95 01 859	window switch-S	3.0 @	30.34 =\$	91.02	161.02
					<b>Job Subtotal: \$338.02</b>

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	177.00
Parts	161.02
Enviromental	3.54
Shop Supplies	10.62
Tax	12.92
Total	\$365.10
Payments	0.00
Bal Due	365.10

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000033354**

**Page 1**  
**Order Date 07/27/19 10:50 am**  
**Completed: 08/14/19 12:51 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

<b>Wert, Joshua</b> 2221 Dwight Lane Minnetonka MN 55305  Hm: Work Phone: 612-965-4040.c	<b>89 Saab 900 Conv` t red</b> 38216 Mi.Last in 6/4/2019 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Eq:
---	--

check/charge battery, get battery tender, low bouncy idle

**Job01 Battery issues** **Labor: \$94.40**

Replace weak battery under warranty. Install connector wire for battery tender. Clean and detail.

021-0123	battery tender-S	1.0 @	76.25 =\$	76.25	
26RMR	battery-S	1.0 @	0.01 =\$	0.01	76.26
					<b>Job Subtotal: \$170.66</b>

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	94.40
Parts	76.26
Enviromental	1.89
Shop Supplies	5.66
Tax	6.17
Total	\$184.38
Payments	0.00
Bal Due	184.38

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000033226**

**Page 1**  
**Order Date 06/04/19 04:28 pm**  
**Completed: 06/14/19 03:54 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

<b>Wert, Joshua</b> 2221 Dwight Lane Minnetonka MN 55305  Hm: Work Phone: 612-965-4040 c	<b>89 Saab 900 Conv't red</b> 38040 Mi. Last in 5/31/2019 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Eq:
---	---

LR window intermittant going up, probable window motor issue

**Job01 Repair LR window** **Labor: \$236.00**

LR window intermittant going up. After removing rear seat, window switch pack, and LR interior trim to access and test circuits, we were able to conclude that the LR window switch was intermittant. The window switches have a relay equivilant built into the switches, making circuit diagnosis more difficult. Repair made was to replace unavailable rear switches with new front switches. Switches and mounting panel were trimmed slightly to fit front switches in rear position. Now all switches are new, and all switches light up. The original problem was one switch did not light up, and switch markings looked work on some of the switches. Hopefully the switches will continue to work without incident. Between the repair and prior repair we have well over 8 hours into working with window switches that originally had a cosmetic fault. Prior charge 1 hour labor.

95 01 859	window switch-S	1.0 @	29.00 =\$	29.00	29.00
					<b>Job Subtotal: \$265.00</b>

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	236.00
Parts	29.00
Enviromental	4.72
Shop Supplies	14.16
Tax	3.25
Total	\$287.13
Payments	0.00
Bal Due	287.13

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000033211**

**Page 1**  
**Order Date 05/31/19 03:53 pm**  
**Completed: 05/31/19 04:34 pm**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

**Wert, Joshua**  
2221 Dwight Lane  
Minnetonka MN 55305

Hm:  
Work Phone: 612-965-4040 c

**89 Saab 900 Conv't red**  
37983 Mi.Last in 10/1/2018  
Lic: 8BDB563/CA 4Cyl Eng  
Vin: YS3AT75L3K7020477 03/89  
Eq:

**Job01 Repair water on floor**

**Labor: \$118.00**

Water on back seat floor after recent hard rain. Remove rear seat bottom to peel up carpets. Use wet vac and box fan to dry out rear floor. Reinstall rear seat bottom. Run water on top to see if leaking/drainng. Found right quarter panel/top drain clogged. Clean and verify top area drains on both sides.

**Job Subtotal: \$118.00**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	118.00
Parts	0.00
Enviromental	2.36
Shop Supplies	7.08
Tax	0.53
Total	\$127.97
Payments	0.00
Bal Due	127.97

**Thank you for choosing Foreign Affairs**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

<p><b>Wert, Joshua</b> 2221 Dwight Lane Minnetonka MN 55305  Hm: Work Phone: 612-965-4040 c</p>	<p><b>89 Saab 900 Conv` t red</b> 37348 Mi.Last in 8/6/2018 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Eq:</p>
---	---

**Job01 Inspection** Labor: \$118.00

Inspect per customer list and general inspect. {1} Noise in reverse/pops out of reverse. This is a common Saab manual transmission issue related to the ignition lock/reverse set up. Full repair usually involves transmission removal to replace reverse gear. There is a method to repair/extend life of existing gear that does not involve remove transmission. We will try that first. {2} Interior lighting issues. Console gauge light and window switch lights are accessible. Dim airflow direction dial would involve a few hours labor to remove HVAC control panel. Recommend leave this issue for now due to lack of new parts available for HVAC controls. {3} Stuck right seat belt. Belt started working, no problem found. {4} Plastic hood latch cover. Still looking for cover. {5} General inspection. Top up fluids, fill tires, check/charge battery.

**Job Subtotal: \$118.00**

**Job02 Repair reverse gear** Labor: \$472.00

Reverse pops out of gear. Research problem. Decide to try modify reverse selector arm per online information. Drain gear box oil. Drain plug is magnetic, found some metal particles and chipped gear teeth on magnet. Can see typical damage to edge of reverse gear. Modify reverse selector arm allows deeper engagement of reverse gear. Refill gear oil with recommended Redline synthetic gear oil. Test drive after repairs. No longer pops out of reverse, reverse has better engagement. **DO NOT ENGAGE REVERSE WHILE CAR IS MOVING.**

50204	Redline gear oil 75/80-S	3.0 @	18.47 =\$	55.41	55.41
-------	--------------------------	-------	-----------	-------	-------

**Job Subtotal: \$527.41**

**Job03 Replace bulb** Labor: \$59.00

Replace bulb in console gauge.

NPN	miniature bulb-S	1.0 @	3.18 =\$	3.18	3.18
-----	------------------	-------	----------	------	------

**Job Subtotal: \$62.18**

**Job04 Replace window switches** Labor: \$118.00

Switches have worn finish and RR switch has burnt out bulb. Rear switches not available new. Tried to install new aftermarket front switches in rear position, but bind on trim causing buttons to stick. Obtain and install good used rear switch. Touch up worn buttons. Extra switches in bag in trunk. All switches work and light up.

30 526 039	LF window switch-S	1.0 @	29.00 =\$	29.00	
95 01 859	RF window switch-S	1.0 @	29.00 =\$	29.00	
NPN-USED	rear window switch-S	2.0 @	25.00 =\$	50.00	108.00

**Job Subtotal: \$226.00**

----->----->----->----->----->----->

Continued on the next page----->----->----->

**Invoice No.**  
**000032680**

**Page 2**  
**Order Date 10/01/18 05:42 pm**  
**Completed: 03/15/19 01:20 pm**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

**Job05 RF seat repair** **Labor: \$70.80**

Remove RF seat and take to upholstery shop due to split seam in seat cushion. Install after repair.

SUBLET	repair RF seat cushion-S	1.0 @	260.00 =\$	260.00	260.00
					<b>Job Subtotal: \$330.80</b>

**Job06 Clean and detail** **Labor: \$125.00**

Buff hood and deck lid. Clean and detail engine. Clean interior including leather conditioner on seats and clean floor mats.  
Detail complete.

**Job Subtotal: \$125.00**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments: \$1,000.00  
1 03/08/19 1000.00 AMEX

**Cost Summary**

Labor	962.80
Parts	426.59
Enviromental	19.26
Shop Supplies	28.00
Tax	34.21
Total	\$1470.86
Payments	1000.00
Bal Due	470.86

Thank you for choosing Foreign Affairs

Invoice No.  
000032550

Page 1

Order Date 08/06/18 08:14 am  
Completed: 08/10/18 10:08 am

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

<b>Wert, Joshua</b> 2221 Dwight Lane  Minnetonka MN 55305 Hm: Wk: 612-965-4040 c	<b>89 Saab 900 Conv` t red</b> 37150 Mi.Last in 5/21/2018 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Equipment: Profile:
---	--

died while driving

**Job01 Diagnose/repair runability** **Labor: \$590.00**

Customer states that fuel tank nearly empty, filled up with gas, and engine stalled/won't restart approx. 1/2 mile from gas station. Car towed to shop. Engine will not start. Remove spark plugs and clean fouled plugs. With plugs cleaned, engine starts, but won't keep running. Obviously, fuel and spark are both present for engine to run. Take fuel sample. Can see some water content floating on top of fuel sample. Drain fuel and add 5 gallons fresh fuel. With fresh fuel, engine runs and idles in shop. Check fuel pressure at engine. Fuel pressure is 30 psi, this is low end of fuel pressure spec. Engine will "rev up" with no load at idle. Decide to drive to gas station as test drive, and to fill tank. Engine ran under load for a few hundred yards, then stalled. Engine has no acceleration under load. Tow strap back to shop. Continue testing. Again check fuel pressure. Fuel pressure falls below 30 psi. Check air mass meter and idle control function- no change in problem. Research states that boost fuel pump is more common failure than main pump. Failing boost pump will restrict flow into main pump. Replace boost pump. When boost pump removed found some minimal debris in boost pump pick up screen, no residue in main pump screen. After boost pump installed, engine again runs longer/revs more, but still stalls. Replace main fuel pump since engine continues to act like it is running out of fuel. Mechanical fuel pressure gauge continues to show 30 psi [or slightly less] during testing. Believe the issue is fuel volume, not pressure. After main pump installed, engine again runs longer/revs up stronger. Engine still stalls out after 3-5 minutes of running with no load. Even though fuel pumps and fresh fuel improved the stalling condition, now question whether fuel related. Attach spark tester to engine to see if spark is lost when engine stalls. Spark loss is unusual, but sure enough there is no spark when engine stalls. Check cap and rotor. Both cap and rotor are burnt/running hot enough to melt top of rotor. Replace cap and rotor. Now engine starts/runs with authority. Run to gas station and fill tank. Conclusion is that underlying problem was failed ignition components. Timing of the ignition problem with gas fill up was coincidence. There was some water in gas, but this was not an issue. Since fuel pump replacement had positive result of helping engine to run, these parts were left in at a reduced rate. Fuel pumps believed original to the car. Car now has new cap, rotor, spark plugs, fuel filter, boost pump [list \$167], and main fuel pump [list \$333]. Work order mileage approximate.

NPN	fuel-S	1.0 @	17.02 =\$	17.02
3507436	boost pump-S	1.0 @	110.00 =\$	110.00
61 447	fuel pump-S	1.0 @	250.00 =\$	250.00
03 010	distributor cap-S	1.0 @	17.70 =\$	17.70
04 168	rotor-S	1.0 @	31.00 =\$	31.00
NPN	fuel-S	1.0 @	0.00 =\$	0.00
				<b>Job Subtotal: \$1,015.72</b>

<b>Payments to Foreign Affairs</b>	<b>Cost Summary</b>
	Labor 590.00
	Parts 425.72

----->----->----->---Continued on the next page--->----->----->----->



**Invoice No.**  
**000032550**

**Order Date 08/06/18 08:14 am**  
**Completed: 08/10/18 10:08 am**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**Payments to Foreign Affairs**

**Cost Summary**

<b>Enviromental</b>	<b>11.80</b>
<b>Shop Supplies</b>	<b>28.00</b>
<b>Tax</b>	<b>34.15</b>
<b>Total</b>	<b>\$1,089.67</b>
<b>Payments</b>	<b>0.00</b>
<b>Bal Due</b>	<b>1,089.67</b>

**Status: Completed Work Order**

**Payments:**

**Thank you for choosing Foreign Affairs**

**MACH 1 THE SPEED OF SOUND**  
8580 EXCELSIOR BLVD

**THANK YOU**

001  
P

INVOICE

Created On: 03/12/2018

HOPKINS MN 55343-  
(952) 933-7357 Fax: (952) 933-8498  
www.mach1-audio.com

INVOICE	TYPE	DATE	TIME	PAGE#	
A	34628	RETAIL	05/22/2018	11:33:30 AM	1

CUSTOMER INFORMATION	
Wert, Joshua 2221 Dwight Lane	VIP#
Hopkins MN 55305 Home: (612) 965-4040 Work: GOOGLE	Cell:

DEALER INFORMATION	
	ID#
STK:	PO: RO:

AUTOMOBILE DESCRIPTION	
Make: SAAB	Model: 9000
Year: 1989	Color:
VIN#:	
Odometer:	
Registration:	

APPOINTMENT INFORMATION	
Sales1: Anna	Day: Monday Bay#: 0
Sales2:	Date: 05/21/2018
Start Time: 01:56 PM	Stop Time: 01:56 PM

JOB DESCRIPTION	
please remove sirius xm antenna Talk to Dick from Foreign Affairs about getting and taking car	

QTY.	MODEL	MAKE	DESCRIPTION	SERIAL NO.	PRICE	SUBTOTAL
1	DEHX8800BHS	PIONEER	HD Radio/BT/USB/Aux/SXM Ready	QGUE008586UC	\$179.99	\$179.99
-1	SALE	MACH 1	Inventory Blowout Sale	SALE	\$20.00	-\$20.00
-1	DEHX6800BS	PIONEER	AM/FM/CD/BT Receiver	DEHX6800BS	\$119.99	-\$119.99
1	SALE	MACH 1	Anniversary Sale	SALE	\$36.00	\$36.00

LABOR/SUBLET DESCRIPTION
SUBLET:

Materials:	\$76.00
Labor:	\$0.00
Sublet:	\$0.00
Other:	\$0.00
Misc:	\$0.00
SubTotal:	76.00
Sales Tax:	\$5.72
<b>Invoice</b>	<b>\$81.72</b>

TERMS & CONDITIONS
All materials have a manufacturer warranty and installation is guaranteed for one year. Installation kits, filters, wiring harnesses are additional charges if needed. Engine noise removal may be necessary after component install.
SEVEN DAY RETURN POLICY. NO REFUNDS on installed equipment. Payment by check requires a 10 day waiting period for refund. Visit our website: <Insert Your Company website here>
Signature below constitutes awareness that is against the law to operate television/video in the view of the driver while the vehicle is in motion. Herein Company is not responsible or liable for any accidents or fines for customer's failure to abide by this law.
X _____ Date _____

HOW PAID	
Paid Cash :	
Paid Charge :	\$81.72
Card Info : AMEX*****	2109
Auth. Code :	
Gift Card:	
Gift Cert:	
Paid Check : Chk#	
Paid House :	
A/R Open : Due:	
Deposit : Type: CHRG	\$81.72
Last Paid: 05/21/2018 CHRG	\$81.72
Balance	

**Invoice No.**  
**000032347**

**Page 1**  
**Order Date 05/21/18 02:34 pm**  
**Completed: 05/23/18 09:59 am**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

<b>Wert, Joshua</b> 2221 Dwight Lane  Minnetonka MN 55305 Hm: Wk: 612-965-4040 c	<b>89 Saab 900 Conv` t red</b> 35638 Mi.Last in 5/4/2018 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Equipment: Profile:
---	---

repair both door windows. Right door window sticks going down, left is noisy.

**Job01 Repair door windows** **Labor: \$271.40**

1| Right window only goes down a few inches. Remove interior trim panel for repairs. Found rear window track bolts fallen out, one in car, and one in bottom of door. Tighten window track back in place. Lube/adjust mechanism. Window works well.  
2| Driver window noisy during up/down travel. Remove interior trim panel for repairs. Found left door window regulator has had prior repairs. Wrong length bolts are hitting during operation. Replace questionable bolts with shorter bolts. Lube/adjust mechanism. Left window works well, but is slower than right side due to prior repair and more use of driver window.

**Job Subtotal: \$271.40**

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

<b>Labor</b>	<b>271.40</b>
<b>Parts</b>	<b>0.00</b>
<b>Enviromental</b>	<b>5.43</b>
<b>Shop Supplies</b>	<b>16.28</b>
<b>Tax</b>	<b>1.23</b>
<b>Total</b>	<b>\$294.34</b>
<b>Payments</b>	<b>0.00</b>
<b>Bal Due</b>	<b>294.34</b>

Thank you for choosing Foreign Affairs

**Invoice No.**  
**000032317**

**Page 1**  
**Order Date 05/04/18 11:08 am**  
**Completed: 05/15/18 01:09 pm**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

<b>Wert, Joshua</b> 2221 Dwight Lane  Minnetonka MN 55305 Hm: Wk: 612-965-4040 c	<b>89 Saab 900 Conv't red</b> 35347 Mi.Last in 3/12/2018 Lic: 8BDB563/CA 4Cyl Eng Vin: YS3AT75L3K7020477 03/89 Equipment: Profile:
---	---

misfire on hard acceleration, gas smell in cabin

**Job01 Repair fuel smell** **Labor: \$177.00**

Customer states fuel smell present since car picked up. Do smell slight fuel smell. Car arrived with fuel almost empty. Fill fuel to help check fuel smell. Inspect for fuel leak. Found small fuel hose from fuel rail to pressure regulator is dripping on top of engine at a slow rate. This is a plastic hose with rubber cover that is shrink fit to metal ends. Hose not readily available. Trim plastic hose from metal ends. Replace plastic hose with rubber fuel injection hose clamped at both ends. Leak is resolved.

NPN	fuel hose & clamps-S	1.0 @	6.82 =\$	6.82
NPN	fuel-S	1.0 @	25.34 =\$	25.34
				<b>Job Subtotal: \$209.16</b>

**Job02 Rough run** **Labor: \$94.40**

Engine runs rough/misfires at 4000 rpm's and up. Misfire improved when fuel leak repaired, but still present. Replace spark plugs. Engine runs smooth up to redline with new spark plugs.

6282	NGK spark plugs-S	4.0 @	4.77 =\$	19.08
				<b>Job Subtotal: \$113.48</b>

**Job03 Replace valve cover gasket** **Labor: \$0.00**

Warranty repair, replace valve cover gasket due to still leaking at front lower corner. Leak creating slight burnt oil smell.

88 22 041	valve cover gasket-S	1.0 @	0.00 =\$	0.00
				<b>Job Subtotal: \$0.00</b>

**Payments to Foreign Affairs**

Status: Completed Work Order

Payments:

**Cost Summary**

Labor	271.40
Parts	51.24
Enviromental	5.43
Shop Supplies	16.28
Tax	5.09
Total	\$349.44
Payments	0.00
Bal Due	349.44

Thank you for choosing Foreign Affairs



ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

**Job05 Replace valve cover gasket**

88 22 041	valve cover gasket-S	1.0 @	28.79 =\$	28.79
NPN	Brakleen spray cleaner-S	4.0 @	3.99 =\$	15.96
				Job Subtotal: \$221.75

**Job06 Replace waterpump & belts** Labor: \$413.00

Waterpump leaking coolant due to failed gasket. Water pump bearing is slightly rough. Belts are dried out/cracking. Replace waterpump and belts. Fill coolant.

88 17 900	water pump-S	1.0 @	33.67 =\$	33.67
93 185 052	belt set [2]-S	1.0 @	10.62 =\$	10.62
13 X 1175	belt-S	1.0 @	19.42 =\$	19.42
10 X 825	belt-S	1.0 @	9.53 =\$	9.53
NPN	coolant-S	1.0 @	21.50 =\$	21.50
				Job Subtotal: \$507.74

**Job07 Repair HVAC** Labor: \$472.00

Heater control stuck hot from lack of use. Temperature knob seems disconnected from heater valve. AC compressor does not turn on. Temperature control needs to be on "cold" for compressor to run. Start with repair hot/cold knob. Disassemble heater control panel and left upper dash for access to knob linkage and heater valve. Found linkage rod plastic end broken at heater valve. Obtain good used linkage rod and install. Spray penetrant on heater valve and work free. Heater valve now turns freely hot to cold when temperature knob is turned. Now when temperature is in blue zone, AC compressor will come on. AC blows cold with no repairs. Car now has heat and AC. Heat is adjustable cool to hot.

NPN-USED	hot/cold linkage rod-S	1.0 @	40.00 =\$	40.00
				Job Subtotal: \$512.00

**Job08 Misc. cosmetic repairs** Labor: \$295.00

1] Apply multiple coats of leather conditioner to soften seat leather. 2] Remove rear seat for upholstery repairs- split seam. Seat required re-sew all seams due to dried out/breaking thread. Also sew loose heel pad on driver floor mat and torn snap on owners manual packet. Reinstall seat. 3] Remove rear seat speaker covers and reglue loose trim covering on speaker covers. 4] Remove stickum from RF speaker cover after stereo installer removed attached device. 5] Find longer screw to hold RR under dash panel that is loose where amp/speaker wires run to under pass. seat. 6] Remove/install driver door interior trim panel to repair/dye door trim. 7] Glue loose/broken seat release lever onto right seat. 8] Replace missing screws in right side dash speaker grille.

NPN	leather treatment-S	1.0 @	18.95 =\$	18.95
SUBLET	rear seat repair-S	1.0 @	290.00 =\$	290.00
SUBLET	Lt. door trim repair-S	1.0 @	185.00 =\$	185.00
				Job Subtotal: \$788.95

**Job09 Misc. mechanical repairs** Labor: \$354.00

1] lube all hinges/latches/locks 2] reroute/repair radio wire melting by exhaust 3] Replace burnt out RR outer brake bulbs. Replace defogger switch, left mirror switch, main light switch and bulb due to malfunctions present.

----->----->----->----->----->----->----->

**Invoice No.**  
**000032204**

**Page 3**

ForeignAffairsMN.com  
8790 Excelsior Blvd.  
Hopkins, MN 55343  
Phone: 952-939-9282 FAX: 952-935-8268

**Order Date 03/12/18 08:26 am**  
**Completed: 04/27/18 10:58 am**

**Job09 Misc. mechanical repairs**

1156	brake light bulb-S	2.0 @	2.27 =\$	4.54
NPN- USED	defogger switch-S	1.0 @	25.00 =\$	25.00
NPN-USED	4-way mirror switch-S	1.0 @	25.00 =\$	25.00
NPN-USED	headlight switch-S	1.0 @	40.00 =\$	40.00

**Job Subtotal: \$448.54**

**Job10 General maintenance**

**Labor: \$118.00**

1| Replace original fuel filter. 2| Check fluids, tire pressure, etc.

31262352	fuel filter-S	1.0 @	39.45 =\$	39.45
----------	---------------	-------	-----------	-------

**Job Subtotal: \$157.45**

**Job11 "TO DO"**

**Labor: \$0.00**

1| rubber sleeve missing from hood release handle under dash. 2| fog lights removed from below front bumper 3| headlights have light clouding that would require remove light and internally clean 4| monitor for oil leak from pan gasket or other gaskets below valve cover gasket 5| valve tick or possibly exhaust tick when engine first started. Monitor ticking noise. May improve with exercise.

**Job Subtotal: \$0.00**

**Payments to Foreign Affairs**

**Cost Summary**

Status: Completed Work Order

Payments: \$2,000.00  
1 03/27/18 2000.00 Check

Labor	2,291.40
Parts	973.97
Sublet	125.00
Enviromental	45.83
Shop Supplies	28.00
Tax	75.40
Total	\$3,539.60
Payments	2,000.00
Bal Due	1,539.60

Thank you for choosing Foreign Affairs

# VEHICLE INSPECTION FORM

YEAR 89 MAKE SAAB MODEL 900 Turbo

PRODUCTION DATE 3/89 ENG SIZE \_\_\_\_\_  
 LIC PLATE / STATE 8BDR563 TRANS AUTO / MANUAL  
 MILEAGE 35064 COLOR red

1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17  
MIS13A7175L3K70201477

INSPECT	OK	SUG	REQ	SCHED MAINT	WHY RECOMMENDED
WIPER BLADES	X				<input type="checkbox"/> FRONT <input type="checkbox"/> REAR
HEADLIGHTS	X				
MINI LIGHTS	X				<input type="checkbox"/> BRAKE <input type="checkbox"/> TURN <input type="checkbox"/> LICENSE <input type="checkbox"/> PARKING
AIR FILTER	X				
CABIN AIR FILTER	X				
PCV VALVE	X				
WASHER FLUID	X				
OIL LEVEL	X				
POWER STR. FLUID LEVEL	X				OVER 50K: Y / N
MASTER CYL. FLUID LEVEL	X				<input type="checkbox"/> BRAKE INSPECTION
BRAKE FLUID FLUSH	X				
TRANS. SERVICE	X				<input type="checkbox"/> FLUSH <input type="checkbox"/> PAN SERVICE
COOLANT LEVEL FLUSH	X				
COOLANT HOSES	X				<input type="checkbox"/> UPPER <input type="checkbox"/> LOWER <input type="checkbox"/> BYPASS <input type="checkbox"/> HEATER
BELTS	X	X			<input type="checkbox"/> ALT <input type="checkbox"/> A/C <input type="checkbox"/> P/S <input type="checkbox"/> AIR BELTS 1 2 3 4
BATTERY TEST	X				<input type="checkbox"/> GOOD <input type="checkbox"/> MARGINAL <input type="checkbox"/> REPLACE
BATTERY ACCESSORIES	X				<input type="checkbox"/> CABLE ENDS / CABLES <input type="checkbox"/> POS NEG <input type="checkbox"/> HOLD DOWN
BATTERY	X				<input type="checkbox"/> CORROSION <input type="checkbox"/> PREVENTATIVE
START/CHARGE TEST	X				
BELT TENSIONER	X				
SPARK PLUGS	X				
FUEL FILTER	X	X			<i>mileage 192</i>
IGNITION WIRES	X				
VALVE COVER GASKET	X	X			<i>leaking</i>
POWER STR. HOSE	X				<input type="checkbox"/> PRESSURE <input type="checkbox"/> RETURN
TIMING BELT	X				

TIRE SIZE		TIRE BRAND / MODEL	
F			
R			

INSPECT	OK	SUG	REQ	WHY RECOMMENDED
<b>LEFT FRONT</b>				
PSI IN				<input type="checkbox"/> CUPPING <input type="checkbox"/> BEAD LEAK
PSI OUT				<input type="checkbox"/> CRACKING <input type="checkbox"/> NAIL / SCREW
				<input type="checkbox"/> SIDEWALL <input type="checkbox"/> VALVE STEM
<b>RIGHT FRONT</b>				
PSI IN				<input type="checkbox"/> CUPPING <input type="checkbox"/> BEAD LEAK
PSI OUT				<input type="checkbox"/> CRACKING <input type="checkbox"/> NAIL / SCREW
				<input type="checkbox"/> SIDEWALL <input type="checkbox"/> VALVE STEM
<b>RIGHT REAR</b>				
PSI IN				<input type="checkbox"/> CUPPING <input type="checkbox"/> BEAD LEAK
PSI OUT				<input type="checkbox"/> CRACKING <input type="checkbox"/> NAIL / SCREW
				<input type="checkbox"/> SIDEWALL <input type="checkbox"/> VALVE STEM
<b>LEFT REAR</b>				
PSI IN				<input type="checkbox"/> CUPPING <input type="checkbox"/> BEAD LEAK
PSI OUT				<input type="checkbox"/> CRACKING <input type="checkbox"/> NAIL / SCREW
				<input type="checkbox"/> SIDEWALL <input type="checkbox"/> VALVE STEM
<b>SPARE</b>				
PSI IN				<input type="checkbox"/> CUPPING <input type="checkbox"/> BEAD LEAK
PSI OUT				<input type="checkbox"/> CRACKING <input type="checkbox"/> NAIL / SCREW
				<input type="checkbox"/> SIDEWALL <input type="checkbox"/> VALVE STEM
<b>TIRE MAINT</b>				<input type="checkbox"/> ROTATION <input type="checkbox"/> BALANCE
<b>ALIGNMENT</b>				<input type="checkbox"/> MAINTENANCE <input type="checkbox"/> TIRE WEAR


INSPECT	OK	SUG	REQ	WHY RECOMMENDED
<b>FRONT PADS</b>	X			LF M.M. <input type="checkbox"/> SENSOR <input type="checkbox"/> RF M.M.
<b>FRONT CALIPERS</b>	X			YES / NO
<b>FRONT ROTORS</b>	X			
<b>REAR PADS</b>	X			LR M.M. <input type="checkbox"/> SENSOR <input type="checkbox"/> RR M.M.
<b>REAR CALIPERS</b>	X			YES / NO
<b>REAR ROTORS</b>	X			
<b>HARDWARE</b>	X			<input type="checkbox"/> FRONT <input type="checkbox"/> REAR
<b>E-BRAKE CABLE</b>	X			<i>Visual</i>
<b>FRONT BRAKE HOSES</b>	X			
<b>REAR BRAKE HOSES</b>	X			
<b>WHEEL CYLINDERS</b>	X			

INSPECT	OK	SUG	REQ	WHY RECOMMENDED
<b>EXHAUST SYSTEM</b>	X			<input type="checkbox"/> MANIFOLD <input type="checkbox"/> DOWN <input type="checkbox"/> FLEX <input type="checkbox"/> CAT <input type="checkbox"/> O2 <input type="checkbox"/> MUFFLER

IMPROVED PERFORMANCE SUGGESTIONS	
BRAKE FLUSH	EVERY 2 YEARS
POWER STR. FLUSH	EVERY 50K
FUEL SYSTEM SERVICE	EVERY 12K
TRANS FLUSH	EVERY 1 - 2 YEARS
WHEEL ALIGNMENT	EVERY 6 MONTHS
COOLANT FLUSH	EVERY 1 - 2 YEARS
WHEEL BALANCE	EVERY ROTATION

OK Checked & Acceptable	REPAIR/REPLACEMENT SUGGESTED	REPAIR/REPLACEMENT REQUIRED
	1. Close to end of useful life 2. Address customer request/need/convenience 3. Comply with manufacturer recommendation 4. Technician recommendation from experience	A. No longer performs intended purpose B. Does not meet design specification C. Missing

VEHICLE DAMAGE	YES / NO
CRACKED WINDSHIELD	
SCRATCHES DENTS	
MISSING TRIM	

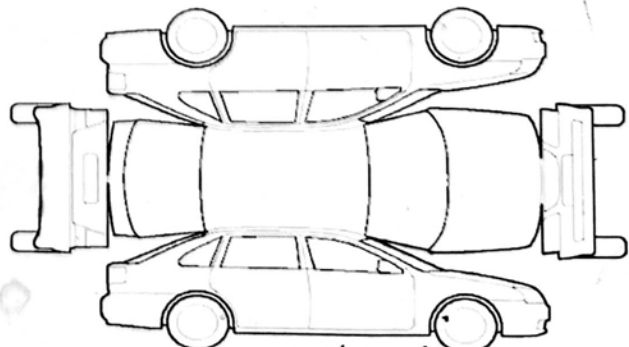

NOTES *A/c does not work* *rear window switches switched around*  
*LF headlight bracket broken* *fog lights missing*  
*valve cover split gasket and head gasket*  
*water pump*



# MACH 1 THE SPEED OF SOUND

8580 EXCELSIOR BLVD

# THANK YOU

001

P

DUPLICATE

Created On: 03/12/2018

HOPKINS MN 55343-  
 (952) 933-7357 Fax: (952) 933-8498  
 www.mach1-audio.com

INVOICE	TYPE	DATE	TIME	PAGE#
A 33955	RETAIL	4/19/2018	10:39:52 AM	1

CUSTOMER INFORMATION	
Wert, Joshua	VIP#
2221 Dwight Lane	
Hopkins MN 55305	
Home: (612) 965-4040	Work: Cell:
GOOGLE	

DEALER INFORMATION	
ID#	
Ext:	
STK:	PO: RO:

AUTOMOBILE DESCRIPTION		
Make: SAAB	Model: 9000	
Year: 1989	Color:	
VIN#:		
Odometer:		
Registration:		

APPOINTMENT INFORMATION		
Sales1: Anna	Day: Thursday	Bay#: 2
Sales2:	Date: 04/19/2018	
Start Time: 09:00 AM	Stop Time: 10:30 AM	

### JOB DESCRIPTION

please remove sirius xm antenna  
 Talk to Dick from Foreign Affairs about getting and taking car

QTY.	MODEL	MAKE	DESCRIPTION	SERIAL NO.	PRICE	SUBTOTAL
1	DEHX6800BS	PIONEER	AM/FM/CD/BT Receiver	PETM000575UC	\$119.99	\$119.99
-1	SALE	MACH 1	anniversary sale	SALE	\$36.00	-\$36.00
1	MACH1	LABOR	radio with Bluetooth	KLC;1	\$70.00	\$70.00
1	MACH1	LABOR	hardwire radio	KLC;1	\$50.00	\$50.00
1	SHOP	SUPPLIES	STANDARD SHOP SUPPLIES	SHOP	\$8.00	\$8.00

LABOR/SUBLET DESCRIPTION
SUBLET:

Materials:	\$91.99
Labor:	\$120.00
Sublet:	\$0.00
Other:	\$0.00
Misc:	\$6.00
SubTotal:	217.99
Sales Tax:	\$15.96
<b>Invoice</b>	<b>\$233.95</b>

TERMS & CONDITIONS
All materials have a manufacturer warranty and installation is guaranteed for one year. Installation kits, filters, wiring harnesses are additional charges if needed. Engine noise removal may be necessary after component install.
SEVEN DAY RETURN POLICY. NO REFUNDS on installed equipment. Payment by check requires a 10 day waiting period for refund.
Visit our website: <Insert Your Company website here>
Signature below constitutes awareness that is against the law to operate television/video in the view of the driver while the vehicle is in motion. Herein Company is not responsible or liable for any accidents or fines for customer's failure to abide by this law.
X _____ Date _____

HOW PAID	
Paid Cash :	
Paid Charge :	\$233.95
Card Info :	M/C***** 1907
Auth. Code :	
Gift Card:	
Gift Cert:	
Paid Check : Chk#	
Paid House :	
A/R Open : Due:	
Deposit : Type: CHRG	\$233.95
Last Paid: 4/18/2018 CHRG	\$233.95
Balance	

# Smog Check Vehicle Inspection Report (VIR)

## Vehicle Information

Test Date/Time: 09/23/2017 @ 14:21

Model Year: 1989	Make: SAAB	Model: 900 TURBO
License: NONE	State: Unknown	VIN: YS3AT75L3K7020477
Engine Size: 2.0 L	Type: Passenger	Transmission: Manual
GVWR: N/A	Test Weight: 3250	Cylinders: 4
Odometer: 34949	Certification: California	VLT Record #: 21488
Fuel Type: Gasoline	Exhaust: Single	Inspection Reason: Initial Registration

## Overall Test Results

**Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.**

Smog Check Certificate Number: HF410962  
DMV ID Number: 7005F747H737

Your Smog Check certificate has been electronically transmitted to DMV.  
Your certificate is valid for 90 days from date of issuance.  
Please keep this copy for your records.

## Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test)

Result	ECS	Result	ECS	Result	ECS
Pass	PCV	N/A	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	N/A	Air Injection	Pass	OBD System Checks
N/A	EGR Visual	Pass	Vacuum Lines to Sensors/ Switches	Pass	Carb./Fuel Injection
N/A	EGR Functional		Ignition Timing: 16 BTDC	Pass	Other Emission Related Components
Pass	Fuel Cap Functional	Pass	Wiring to Sensors	Pass	Oxygen Sensor
Pass	Fuel Cap Visual	Pass	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Pass	Spark Controls				
Pass	Fuel Evaporative Controls Functional				

## ASM Emission Test Results

Test	RPM	%CO <sub>2</sub>		HC (PPM)			CO (%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1754	15.2	0.1	116	35	45	0.52	0.11	0.25	791	313	622	PASS
25 mph	1975	15.1	0.0	63	26	27	0.62	0.08	0.13	730	237	469	PASS

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

No match has been found or test has been performed offline. The Consumer is responsible for retaining the VIR for reference throughout the vehicle registration process.

## Smog Check Inspection Station Information

Walnut Creek Smog  
1433 MAZDA DR. WALNUT CREEK CA 94597  
925-938-1646  
Station Number: TC265101

Technician Name/Number: DELACUADRA, JOSEPH/E0639485  
Repair Tech Name/Number:  
Software Version/EIS Number: 1301/ES315703

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

9/23/17

Date

Technician's Signature



# Dirito Brothers

WALNUT CREEK

1890 North Main Street  
WALNUT CREEK, CALIFORNIA 94596-4195  
(925) 934-8224

CALIF. B.A.R. REG. # 257857  
EPA # CAL000300319

CUSTOMER NO. <b>56974</b>		ADVISOR <b>TERI</b>	1114	TAG NO. <b>978</b>	INVOICE DATE <b>05/14/09</b>	INVOICE NO. <b>SACS11696</b>	
GARY TAMKIN 4 VALLEY HIGH LAFAYETTE, CA 94549-2418		LICENSE NO. <b>CARDNAL</b>	MILEAGE <b>32,084</b>		COLOR <b>RED/</b>	STOCK NO.	
		YEAR / MAKE / MODEL <b>89/SAAB/900 CONV, 16VT, M/T</b>				DELIVERY DATE	DELIVERY MILES
		VEHICLE ID NO. <b>Y S 3 A T 7 5 L 3 K 7 0 2 0 4 7 7</b>				SELLING DEALER NO.	PRODUCTION DATE
		F.T.E. NO.		P.O. NO.		R.O. DATE <b>04/21/09</b>	
RESIDENCE PHONE <b>925-962-9414</b>	BUSINESS PHONE <b>925-786-8469</b>	COMMENTS				<b>MO: 32084</b>	

LABOR & PARTS  
J# 1 04SAZ21 MANUAL TRANS CONCERN TECH(S):1212 45.00  
CUST STATES CANNOT GET INTO REVERSE. PLEASE CHECK AND ADVISE  
FOUND GEAR SHIFT KNOB TO LOW ON SHAFT  
REPLACED GEAR SHIFT KNOB AND RECHECKED, OKAY AT THIS TIME.

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
JOB # 1	1	75-44-828	GEARSHIFT KNOB	43.60	43.60
JOB # 1	1	87-18-439	WASHER	3.00	3.00
				JOB # 1 TOTAL PARTS	46.60
				JOB # 1 TOTAL LABOR & PARTS	91.60

J# 2 04SAZ1 CLUTCH TECH(S):1212 225.00  
CUST STATES GRINDS IN ALL GEARS. PLEASE CHECK AND ADVISE  
FOUND CLUTCH MASTER CYLINDER LEAKING INTERNALLY  
REPLACED CLUTCH MASTER CYLINDER AND BLEED SYSTEM

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
JOB # 2	1	89-44-977	MASTER CYLINDER	194.00	194.00
				JOB # 2 TOTAL PARTS	194.00
				JOB # 2 TOTAL LABOR & PARTS	419.00

J# 3 03SAZ07 BATTERY TECH(S):1212 75.00  
CUST STATES BATTERY KEEPS BEING DRAINED. PLEASE CHECK AND ADVISE  
FOUND BATTERY DEAD CHARGED BATTERY AND TESTED 12.63V  
FAILED CHECKED DRAW FOUND 60 MILLIAMPS  
RECHECKED DRAW, FOUND 26 MILLIAMPS, OKAY AT THIS TIME  
REPLACED BATTERY AND CLEANED CABLES.

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
JOB # 3	1	02-50-191	BATTERY A26RWRN	93.95	93.95
				JOB # 3 TOTAL PARTS	93.95
				JOB # 3 TOTAL LABOR & PARTS	168.95

J# 4 01SA5995 OIL & FILTER CHANGE TECH(S):1212 30.50  
CHANGE ENGINE OIL AND FILTER  
CHECK AND TOP OFF FLUID LEVELS  
PERFORMED OIL, LUBE AND FILTER CHANGE, TOPPED OFF FLUIDS,  
SET TIRE PRESSURES

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	
JOB # 4	1	PKLOF	LUBE OIL FILTER	****	****
JOB # 4	1	93-186-554	OIL FILTER	9.60	9.60
JOB # 4	4	02-21-317	OIL FULLSYN WTY	8.10	32.40
JOB # 4	1	91-32-937	SEAL WASHER	2.50	2.50
				JOB # 4 TOTAL PARTS	44.50
				JOB # 4 TOTAL LABOR & PARTS	75.00

J# 5 07SAZ18 ROTATE TIRES TECH(S):1212

Thank you for choosing  
**Dirito Brothers**  
as your Servicing Dealer.

**WE APPRECIATE  
YOUR BUSINESS.**

**NOTICE TO CUSTOMER:  
PLEASE READ IMPORTANT  
INFORMATION ON BACK.**

# Dirito Brothers

WALNUT CREEK

1890 North Main Street  
 WALNUT CREEK, CALIFORNIA 94596-4195  
 (925) 934-8224

CALIF. B.A.R. REG. # 257857  
 EPA # CAL000300319

Do not smoke, drink, or use any other vehicles, parts, and parts components pertaining to



CUSTOMER NO. <b>56974</b>	ADVISOR <b>TERI</b>	TAG NO. <b>1114 978</b>	INVOICE DATE <b>05/14/09</b>	INVOICE NO. <b>SACS11696</b>
<b>GARY TAMKIN 4 VALLEY HIGH LAFAYETTE, CA 94549-2418</b>	LICENSE NO. <b>CARDNAL</b>	MILEAGE <b>32,084</b>	COLOR <b>RED/</b>	STOCK NO.
	YEAR / MAKE / MODEL <b>89/SAAB/900 CONV, 16VT, M/T</b>		DELIVERY DATE	DELIVERY MILES
	VEHICLE I.D. NO. <b>Y S 3 A T 7 5 L 3 K 7 0 2 0 4 7 7</b>		SELLING DEALER NO.	PRODUCTION DATE
	F.T.E. NO.	P.O. NO.	R.O. DATE <b>04/21/09</b>	
RESIDENCE PHONE <b>925-962-9414</b>	BUSINESS PHONE <b>925-786-8469</b>	COMMENTS <b>MO: 32084</b>		

CUSTOMER REQUESTS TIRE ROTATION  
 .35  
 ROTATE NOT NEEDED FOUND 8/32F 5/32R

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE
			JOB # 5 TOTAL PARTS	0.00
			JOB # 5 TOTAL LABOR & PARTS	0.00
MISC	CODE	DESCRIPTION	CONTROL NO	
JOB # 1	D5	SA LABOR DISCOUNTS/COUPONS		-25.00
JOB # 1	D13	SA PARTS DISCOUNTS/COUPONS		-25.00
TOTAL - MISC				-50.00

ESTIMATE  
 CUSTOMER HEREBY ACKNOWLEDGES RECEIVING  
 ORIGINAL ESTIMATE OF \$440.00 (+TAX)  
 APPROVED REVISED ESTIMATE (# 1) OF \$950.00 (+TAX) ON 05/06/09 AT 04:53pm  
 BY GARY COMMENTS MASTER CYLINDER, KNOB & DRAW  
 TOTALS

*****	TOTAL LABOR....	375.50
*	TOTAL PARTS....	379.05
* [ ] CASH [ ] CHECK [ ] CK NO.	TOTAL SUBLET...	0.00
*	TOTAL G.O.G....	0.00
* [ ] VISA [ ] MASTERCARD	TOTAL MISC CHG.	0.00
*	TOTAL MISC DISC	-50.00
* [ ] OTHER [ ] A/R	TOTAL TAX.....	35.06
* DATE PAID / / CASHIERS INITIALS	<b>TOTAL INVOICE \$</b>	<b>739.61</b>
*****		

Thank you for choosing  
**Dirito Brothers**  
 as your Servicing Dealer.

**WE APPRECIATE  
 YOUR BUSINESS.**

**NOTICE TO CUSTOMER:  
 PLEASE READ IMPORTANT  
 INFORMATION ON BACK.**

WE THANK YOU FOR YOUR BUSINESS

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN  
 INCREASE IN THE ORIGINAL ESTIMATED PRICE

\_\_\_\_\_  
 CUSTOMER SIGNATURE



INVOICE WH: 20

AUTOHAUS, INC.  
 AUTOHAUS AUTOMOTIVE, INC.  
 2575 MONUMENT BLVD.  
 CONCORD, CA. 94520-3181  
 LIC. #E23799 LIC. #AD087154  
 925-825-7111

NUMBER: 126992  
 PAGE: 1  
 DATE: 06/15/07  
 TERMS: CASH

TERMS STRICTLY CASH UNLESS OTHER ARRANGEMENTS ARE MADE. A late charge at the rate of 1 1/2% per month or 18% per year will be charged on past-due accounts.

SOLD TO:

SHIP TO:

R200003814  
 TAMKIN, SANDRA  
 4  
 VALLEY HIGH

SAME  
 TAMKIN, SANDRA  
 4  
 VALLEY HIGH

SALES ORDER NO.	ORDER DATE	CUSTOMER P.O. NO.	DATE SHIPPED	SHIPPED VIA	SLSM	SLSM
	06/12/07	CA 94549		LAFAYETTE, CA	94549	

ORDERED	SHIPPED	BACK ORD.	ITEM NO.	DESCRIPTION	UNIT PRICE	UNIT	AMOUNT
074376	06/12/07		925-962-9414	NONE		684	684
			VIN#: YS3AT75L3K7020477				
			1989 SAAB 900 TURBO				
			INSTAL DECK WITH XM RADIO				
1	1	0	ALPCDA-9885	CD MP3 REC FULL SPEED IPO	349.99	EA	349.99
1	1	0	TRKXMD1000	UNIVERSAL XM TUNER BOX	59.99	EA	59.99
1	1	0	TRKXMDALP100	SMART DIGITAL ADAPTER	59.99	EA	59.99
1	1	0	MET40-VW10	AFTRMKT RADIO TO VW ANT.	11.00	EA	11.00
2.00	2.00	.00	LABOR660		75.00	HR	150.00
			INSTALL AMP AND SPKRS				
1	1	0	ALPSPS-10C2	S SERIES 4" COAX	79.99	EA	79.99
1	1	0	ALPSPS-17C2	S SERIES 6.5 COAX	85.00	EA	85.00
1	1	0	ALPMRP-F250	V-PWR 4/3/2 4X50	199.95	EA	199.95
1	1	0	PGIAKITB	COMPLTETE 375W INST.KIT 8	30.00	EA	30.00
2	2	0	PGIARX.630	10" (3.0M) GOLD CABLES	20.00	EA	40.00
1.50	1.50	.00	LABOR660		75.00	HR	112.50
1.50	1.50	.00	LABOR628		75.00	HR	112.50
1	1	0	CC		.00	EA	.00

SPECIAL INSTRUCTIONS:

ALL PARTS NEW UNLESS OTHERWISE STATED.  
 ELECTRICAL AND SPECIAL-ORDER PARTS ARE NON-RETURNABLE.  
 WARRANTY AND RETURN REQUESTS MUST BE ACCOMPANIED BY RECEIPT.

MINIMUM CHARGE FOR DIAGNOSIS OF ANY AUTO AIR CONDITIONER IS OUR ADVERTISED MINIMUM, PLUS PARTS AND FREON.

WARRANTY NOTICE  
 STATEMENT CONCERNING AMENDMENTS TO THE SONG-BEVERLY WARRANTY ACT AS FOLLOWS:

"A buyer of this product in California has the right to have this products serviced or repaired during the warranty period. The warranty period will be extended for the number of whole days that the product has been out of the buyer's hands for warranty repairs. If a defect exists within the warranty period, the warranty will not expire until the defect has been fixed. The warranty period will also be extended if the warranty repairs have not been performed due to delays caused by circumstances beyond the control of the buyer, or if the warranty repairs did not remedy the defect and the buyer notifies the manufacturer or seller of the failure of the repairs within 60 days after they were completed. If, after a reasonable number of attempts, the defect has not been fixed, the buyer may return this product for a replacement or a refund, subject in either case, to deduction of a reasonable charge for usage. This time extension does not affect the protections or remedies the buyer has under other laws."

ORIGINAL ESTIMATED PRICE \$ CONTINUED

This estimate is based on our inspection and does not cover any additional parts and labor which may be required after the work has been opened up.

REVISED ESTIMATE \$

I acknowledge notice and oral approval of an increase in the original estimated price.

DATE CONTACTED	CONTACTED VIA	PRICED OK'D BY	NAME
TIME CONTACTED	PHONE PERSON		
	WHO CALLED FROM		
	DEALERSHIP		

RETURN PARTS TO CUSTOMER • WARRANTY PARTS NOT RETURNABLE TO CUSTOMER

An estimate where requested or required for labor and parts necessary for a specific job shall be given to the customer the service dealer in writing and the service dealer may not charge for work done or parts supplied in excess of the estimate without prior consent of the customer. The service dealer may charge a reasonable fee for making the estimate.

I hereby authorized the above work to be done along with the necessary parts and materials. An express mechanics lien hereby acknowledged on the above car to secure the amount thereof. Payment of this invoice is guaranteed by I undersigned and does release the above insurance company from any and all claims as set forth on this invoice. My draft payable to Autohaus Automotive, Inc. I agree to the subset of any work.

"If the work to be performed by Autohaus Automotive, Inc. has been requested through a new or used car dealer on behalf of a purchaser of the vehicle, and the car dealer received payment for said work, the car dealer agrees to hold said fund in trust for payment to Autohaus Automotive, Inc."

X

WE ARE NOT RESPONSIBLE FOR ENGINE INDUCED NOISES, I.E., ALTERNATOR AND ENGINE NOISE

CUSTOMER

234645



INVOICE WH: 20

AUTOHAUS, INC.  
AUTOHAUS AUTOMOTIVE, INC.  
2575 MONUMENT BLVD.  
CONCORD, CA. 94520-3181  
LIC. #E23799 LIC. #AD087154  
925-825-7111

NUMBER: 126992  
PAGE: 2  
DATE: 06/15/07  
TERMS: CASH

TERMS STRICTLY CASH UNLESS OTHER ARRANGEMENTS ARE MADE. A late charge at the rate of 1 1/2% per month or 18% per year will be charged on past-due accounts.

SOLD TO:

SHIP TO:

R200003814  
TAMKIN, SANDRA  
4

SAME  
TAMKIN, SANDRA  
4

SALES ORDER NO.	ORDER DATE	CUSTOMER P.O. NO.	DATE SHIPPED	SHIPPED VIA	SLSM	SLSM
	06/12/07	LAFAYETTE, CA 94549		VALLEY HIGH		LAFAYETTE, CA 94549

ORDERED	SHIPPED	BACK ORD.	ITEM NO.	DESCRIPTION	UNIT PRICE	UNIT	AMOUNT
074376	06/12/07		925-962-9414	NONE		684	684

VIN#: YS3AT75L3K7020477

*com*  
*fresh sm radio*

806700ms

SUBTOTAL: 1290.91  
TAX: 75.56  
TOTAL AMOUNT: 1366.47

PAYMENTS: VISA 1366.47

SPECIAL INSTRUCTIONS:

ALL PARTS NEW UNLESS OTHERWISE STATED.  
ELECTRICAL AND SPECIAL-ORDER PARTS ARE NON-RETURNABLE.  
WARRANTY AND RETURN REQUESTS MUST BE ACCOMPANIED BY RECEIPT.

MINIMUM CHARGE FOR DIAGNOSIS OF ANY AUTO AIR CONDITIONER IS OUR ADVERTISED MINIMUM, PLUS PARTS AND FREON.

WARRANTY NOTICE

STATEMENT CONCERNING AMENDMENTS TO THE SONG-BEVERLY WARRANTY ACT AS FOLLOWS:

"A buyer of this product in California has the right to have this products serviced or repaired during the warranty period. The warranty period will be extended for the number of whole days that the product has been out of the buyer's hands for warranty repairs. If a defect exists within the warranty period, the warranty will not expire until the defect has been fixed. The warranty period will also be extended if the warranty repairs have not been performed due to delays caused by circumstances beyond the control of the buyer, or if the warranty repairs did not remedy the defect and the buyer notifies the manufacturer or seller of the failure of the repairs within 60 days after they were completed. If, after a reasonable number of attempts, the defect has not been fixed, the buyer may return this product for a replacement or a refund, subject in either case, to deduction of a reasonable charge for usage. This time extension does not affect the protections or remedies the buyer has under other laws."

ORIGINAL ESTIMATED PRICE \$                      (OUR BUSINESS!!!)  
This estimate is based on our inspection and does not cover any additional parts and labor which may be required after the work has been opened up.

REVISED ESTIMATE \$                     

I acknowledge notice and oral approval of an increase in the original estimated price.

DATE CONTACTED	CONTACTED VIA	PRICED OK'D BY	NAME
TIME CONTACTED	IN PHONE PERSON		
	WHO CALLED FROM DEALERSHIP		

RETURN PARTS TO CUSTOMER • WARRANTY PARTS NOT RETURNABLE TO CUSTOMER

An estimate where requested or required for labor and parts necessary for a specific job shall be given to the customer the service dealer in writing and the service dealer may not charge for work done or parts supplied in excess of estimate without prior consent of the customer. The service dealer may charge a reasonable fee for making the estimate.

I hereby authorized the above work to be done along with the necessary parts and materials. An express mechanics lien hereby acknowledged on the above car to secure the amount thereof. Payment of this invoice is guaranteed by undersigned and does release the above insurance company from any and all claims as set forth on this invoice. I draft payable to Autohaus Automotive, Inc. I agree to the subset of any work.

"If the work to be performed by Autohaus Automotive, Inc. has been requested through a new or used car dealer on behalf of a purchaser of the vehicle, and the car dealer received payment for said work, the car dealer agrees to hold said work in trust for payment to Autohaus Automotive, Inc."

X *Sandra M. [Signature]*  
WE ARE NOT RESPONSIBLE FOR ENGINE INDUCED NOISES, I.E., ALTERNATOR AND ENGINE NOISES

CUSTOMER

234646

Customer Invoice  
050522  
11/14/2006

**FIRESTONE COMPLETE AUTO CARE  
PLEASANT HILL  
570 CONTRA COSTA BLVD  
PLEASANT HILL, CA. 94523**

Service Advisor:  
05 OSAGYEFO  
925.686.0586

TAMKIN, GARY  
4 VALLEY HIGH  
LAFAYETTE, CA 94549  
925.962.9414 Or 925.962.9414

1982 SAAB 900 [RED]  
4-1985 2.0L SOHC  
Lic #: CARDINAL IA Vin #:  
In: 11/14/06 2:02PM Mileage: 1  
Out: 11/14/06 2:26PM

Store # 028347

RETAIL SALE

REG# AG222518, EPA# CAD98200178E

Description	Article Number	ID	Qty	Unit Price	Extended Price	Job Total
<b>BATTERIES</b>		05				<b>139.99</b>
MT26 INTERSTATE BATTERY	7098493	02TN	1	79.99	79.99	
REMOVE & REPLACE BATTERY	7042145	02NN	1	60.00	60.00	
<b>COURTESY CHECK</b>		05				
COURTESY CHECK	7046930	02NN	1	N/C	N/C	

Technician(s):  
02 DALE COOK

Payment History:

Visa	0438	146.59	47558B
Total Tendered		146.59	

Summary:

Parts	79.99
Labor	60.00
Shop Supplies	0.00
Sub-Total	139.99
Tax (8.25%)	6.60
<b>Total</b>	<b>\$146.59</b>

I have received the above goods and/or services. If this is a credit card purchase, I agree to pay and comply with my cardholder agreement with the issuer.

Customer Signature

**All parts are new unless otherwise specified.**

**\$10 OFF YOUR NEXT PURCHASE OF \$25 OR MORE!**

- 1) Call 1-800-859-9203 or logon to [www.FirestoneCompleteAutoCare.com/Experience](http://www.FirestoneCompleteAutoCare.com/Experience); enter code 028347-050522;
- 2) Write redemption code here: \_\_\_\_\_ . Coupon expires 6 months from date of invoice, good at all participating locations. Must have valid redemption code. May not be combined with any other offer or to reduce existing debt. No copies accepted.

COMMITTED TO PROVIDING A POSITIVE CUSTOMER EXPERIENCE

See  reverse side for Warranty  Information

# GOODYEAR AUTO SERVICE CENTER

A DIVISION OF THE GOODYEAR TIRE & RUBBER COMPANY  
 4119 23RD AVE  
 MOLINE, IL 61265  
 (309) 797-4124  
 FEDERAL TAX ID# 340253240



**INVOICE**  
**079237**

09/27/02 09/27/02  
 12:56 PM 12:56 PM  
 TERR: 1434  
 NONSIG: 901434

PAGE: 01

**BILL TO: MIKE STEFFENSON**  
 2434 EAST RIVER DR  
 DAVENPORT, IA 52803

PHONE 1.....	(309)359-7092	VEH YEAR/MAKE.	89 SAAB
PHONE 2.....		VEHICLE MODEL.	900 TURBO
DATE REQUESTED	09/27/02	VEHICLE COLOR.	
TIME REQUESTED		LICENSE/STATE.	
RETURN PARTS..	NO	ODOMETR IN/OUT	20000 / 20000
SALESMAN.....	020 / 020		
OTHER INFO....	PREPAY - BE IN TUESDAY (10-01-02)		

ACCOUNT #	COB	TC	CUST#	TYPE/STATE	AUTHORIZATION	CREDIT CARD NO.
143400005	V	01	07182	0 IL	027378	4388543029876615

SLSM	TECH	PRODUCT CODE	BC	QTY	DESCRIPTION	CORE	PARTS	LBR/EXCISE	LINE TOT
020		156-446-049-0 QTY. 4 NO.	R	4	P185/65R15 86H S1 EAGLE HP VSRPRTL PJUNFPMA2601		57.00	.00	228.
020	069	041-263	R	4	NEW VALVE STEM		2.99	.00	11.
020	069	044-275 AW	R	4	WHEEL BALANCE - AUTO - STANDARD 4.00 WHEEL WEIGHT MAG		3.95	8.00	47.

COST IS CALCULATED ON THE HOURLY RATE OF 60.00 PER HOUR AND/OR A FLAT RATE OF \$\_\_\_\_\_.

I UNDERSTAND THAT ALL CUSTOM WHEEL LUG NUTS MUST BE RE-TORQUED AFTER 25 MILES AND CHECKED PERIODICALLY.

(signature)

**IF YOU ARE NOT 100% SATISFIED, CALL**  
**ALAN OPPENDIKE**  
**THE STORE MANAGER, AT (309)797-4124**

CHARGED AMOUNT 309.66 STATE TIRE FEE 4.00 TAXABLE AMOUNT 255.76 <b>INVOICE TOTAL</b>	PARTS TOTAL..... 255. LABOR TOTAL..... 32. SUB TOTAL..... 287. SALES TAX..... 17. <b>\$309.66</b>
---	---

CUSTOMER AUTHORIZATION FOR TOTAL

TREAD L/F..... 10/32      TREAD R/F..... 10/32      TREAD R/R..... 10/32      TREAD L/R.....

**SEE REVERSE SIDE FOR IMPORTANT SAFETY WARNING AND WARRANTY INFORMATION**



conv  
 YEAR MAKE MODEL LICENSE NUMBER DEL. DATE VEHICLE I.D. NUMBER SPEEDOMETER TODAY'S DATE  
 89 900 CALDONAL 953 AT 25 L3K 02 0477 07876 6-24-98

I hereby authorize the repair work herein set forth to be done (including parts and materials) and agree to make payment therefor in CASH, unless it is otherwise agreed and so set forth in this order. I understand that as a matter of Iowa law you may retain possession of the vehicle until such cash payment is made. You are not responsible for any delays caused by unavailability of parts or delays in parts shipments nor for loss or damage to vehicle or any articles left in vehicle in case of fire, theft or any other cause beyond our control.  
 ANY WARRANTIES ON PRODUCTS SOLD ARE THOSE MADE BY THE MANUFACTURER. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES, EITHER EXPRESSED OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE AND THIS COMPANY NEITHER ASSUMES NOR AUTHORIZES ANY PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCT OR SERVICE.  
 SIGNATURE: *[Signature]*

TIME REC'D PROMISED PHONE WHEN READY RES. PHONE # BUS. PHONE # WRITTEN BY ADD'L R.O. NO.  
 8:00 CWE YES NO 762-7716  
 NAME Mike Steffenhew  
 ADDRESS 2434 E. River Dr  
 CITY DAN STATE IA ZIP 03

P.O. NUMBER CAR SAVERS AMOUNT  
 LUBE   
 OIL CHANGE   
 CHANGE OIL FILTER CART.   
 7500 MI. SERVICE   
 WASH

YOU HAVE THE RIGHT TO A WRITTEN OR ORAL ESTIMATE IF THE EXPECTED COST OF REPAIRS OR SERVICE WILL BE MORE THAN FIFTY DOLLARS. YOUR BILL WILL NOT BE HIGHER THAN THE ESTIMATE BY MORE THAN TEN PERCENT UNLESS YOU APPROVE A HIGHER ESTIMATE BEFORE REPAIRS ARE FINISHED. INITIAL YOUR CHOICE:  
 Written estimate \_\_\_\_\_ No estimate \_\_\_\_\_  
 Oral estimate \_\_\_\_\_ Call me if repairs and service will be more than \$ \_\_\_\_\_  
 SAVE OLD PARTS  YES  NO

PRELIMINARY EST. \$ This estimate is based on our initial inspection and does not cover any additional parts and labor which may be required after disassembly and inspection. REVISED ESTIMATE \$

OPERATION NO.	T.C.	REPAIR ORDER - LABOR INSTRUCTIONS	AMOUNT
A	6	TOP moves VERY slow Diagnosed and Replaced Both leaking Rims	201.36
B	6	R.R. window is Inop AT times cleaned switch contacts	N/C
C	6	L.F. window BROKE when Door WAS closed w/ window Down - Replaced glass	5034
D	6	STALLS AT STOPS AT times no problem found at this time	N/C

**W CODE RELATING TO LABOR INSTRUCTIONS**

QTY	PART NO	DESCRIPTION	AMOUNT
1	8919 336	GLASS	29000
2	6953 906	Ram	53000

PAID CHECK  
7-3-98

TOTAL	92000
SUBLET REPAIRS	P.O.#
TOTAL SUBLET	
GALS. GAS @	
QTS. OIL @	
LBS. GREASE @	

WE RECOMMEND THE FOLLOWING REPAIRS

**MERCURY LINCOLN SAAB**  
**STRIETER MOTOR COMPANY**  
 OVER 75 YEARS  
 520 W. Kimberly Rd. Phone 391-1500

**ALWAYS BRING YOUR CAR HERE FOR FACTORY AUTHORIZED SERVICE**

... Compare Service, Too!  
 We guarantee our service work for 12 mo. or 12,000 miles, whichever comes first. If our repair or replacement fails in normal service within that period, we'll fix it free of charge. Parts and Labor.  
 We give you a report card... You give us a grade.  
 Our goal: "No unhappy owners."

DESCRIPTION	AMOUNT
LABOR	25170
PARTS	92000
SUBLET REPAIRS	
GAS, OIL & GREASE	
SHOP SUPPLIES	
HAZARDOUS WASTE	
WARRANTY DEDUCTIBLE	
SUB-TOTAL	117170
TAX	7030
CHARGE SALE	
CASH SALE	124000

LITHO IN U.S.A. OK 62511

YEAR MAKE MODEL LICENSE NUMBER DEL. DATE VEHICLE I.D. NUMBER 8735 5-3-93

89 Sub 900 ISU 0481

TIME REC'D PROMISED PHONE WHEN READY RES. PHONE # BUS. PHONE # WRITTEN BY ADD'L R.O. NO.

YES NO 762-7716 359-7092 P

NAME Michael Stephenson P.O. NUMBER

ADDRESS 2434 East Ruess Dr

CITY Iowa STATE ZIP

SIGNED Jean Stephenson ESTIMATE


YOU HAVE THE RIGHT TO A WRITTEN OR ORAL ESTIMATE IF THE EXPECTED COST OF REPAIRS OR SERVICE WILL BE MORE THAN FIFTY DOLLARS. YOUR BILL WILL NOT BE HIGHER THAN THE ESTIMATE BY MORE THAN TEN PERCENT UNLESS YOU APPROVE A HIGHER ESTIMATE BEFORE REPAIRS ARE FINISHED. INITIAL YOUR CHOICE:  YES  NO

SAVE OLD PARTS  YES  NO

Written estimate  No estimate

Oral estimate  Call me if repairs and service will be more than \$

CODE RELATING TO LABOR INSTRUCTIONS			
QTY.	PART NO.	DESCRIPTION	AMOUNT
1	0271262	Battery	96.60
1	OIL ME		4.95
A		REPAIR ORDER - LABOR INSTRUCTIONS	
		Degrease Eng + add oil P/E	Mc
		Check your Oil Leak	
		LEFT OF Eng Wash	
B		Adj Headlights to High	8.00
C		Replace Battery	13.00
D			

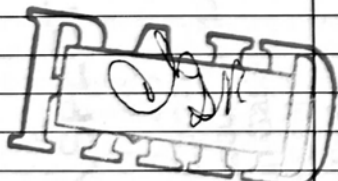

WE RECOMMEND THE FOLLOWING REPAIRS

DESCRIPTION AMOUNT

LABOR 72.00

PARTS 109.55

SUBLET REPAIRS

GAS, OIL & GREASE

SHOP SUPPLIES

WARRANTY DEDUCTIBLE

SUB-TOTAL 123.55

TAX 7.41

CHARGE SALE 130.96

CASH SALE

**TOTAL**

SUBLET REPAIRS P.O. #

**TOTAL SUBLET**

GALS. GAS @

QTS. OIL @

LBS. GREASE @

**ALWAYS BRING YOUR CAR HERE FOR FACTORY AUTHORIZED SERVICE**

... Compare Service, Too!

We guarantee our service work for 12 mo. or 12,000 miles, whichever comes first. If our repair or replacement fails in normal service within that period, we'll fix it free of charge. Parts and Labor.

We give you a report card... You give us a grade. Our goal: "No unhappy owners."

 **SAAB**

**STRIETER MOTOR COMPANY**

OVER 60 YEARS

520 W. Kimberly Rd. Phone 391-1500

THANK YOU



84754

# RAPID LUBE & OIL

15 MINUTE OIL CHANGE  
YOUR AUTOMOTIVE FLUID  
MAINTENANCE AND TUNE-UP SPECIALISTS  
18th & STATE ST., BETTENDORF

359-4516  
MON. - FRI. 8-6 SAT. 8-4

PD. Cash

PARTS		PLEASE PRINT	NAME		ADDRESS		CITY/STATE/ZIP		
			Mr. Stettensen		2439 E River Drive		Bettendorf Ia 52823		
			DATE	CASH	CHECK	M/C	CHARGE	VISA	VEHICLE IDENTIFICATION NUMBER
			11-17-90						K7020477
LABOR		YEAR	MAKE	MODEL	LICENSE	STATE	MILEAGE		
		89	Saab	900	ISU0481	Ia	4465		
		MECH	FLUID LEVELS	OR	MECH	PART NUMBER		AMOUNT	
			MASTER CYLINDER	✓	OIL	① P	Turbo 10w30	19 95	
			POWER STEERING	✓	OIL FILTER		200 Bus. Card		
			BATTERY	✓	AIR FILTER	ou			
			RADIATOR	-3 ✓	BREATHER ELEMENT				
			TRANSMISSION	✓	WIPER BLADES	oil			
			REAR/FRONT-END	✓	TREAD DEPTH				
			CLUTCH FLUID			9.72	10.72		
			WASHER FLUID	✓		10.72	10.72		
SERVICES		AMOUNT							
(recommended every 20,000 miles)									
Transmission Fluid & Filter Change									
(recommended every 2 years)									
Radiator Flush									
Tire Rotation <input type="checkbox"/> Balancing <input type="checkbox"/>									
(recommended every 30,000 miles)									
Tune Up									
(evacuation recommended every 2 years)									
Air Conditioning - recharge/evacuate									
(recommended checking owners manual)									
Differential/Manual Trans. Fluid Change									
(recommended every 25,000 miles)									
Fuel Injection Cleaning									
(recommended changing every 4 years)									
Hoses									

ESTIMATE  
YOU HAVE THE RIGHT TO A WRITTEN OR ORAL ESTIMATE IF THE EXPECTED COST OF REPAIRS OR SERVICE WILL BE MORE THAN FIFTY DOLLARS. YOUR BILL WILL NOT BE HIGHER THAN THE ESTIMATE BY MORE THAN TEN PERCENT UNLESS YOU APPROVE A HIGHER ESTIMATE BEFORE REPAIRS ARE FINISHED. INITIAL YOUR CHOICE.

Written estimate     No estimate     NO  
 Oral estimate     Call me if repairs and Service will be more than \$     YES

TRANSFER TO RIGHT

ORIGINAL ESTIMATE	REVISED ESTIMATE	OK'D BY	DATE
\$	\$		

### CUSTOMER POLICY:

At Rapid Lube and Oil, we sincerely believe that our customers are the most important aspect of our business. In reality, they are the reason for our existence. Because of this we have always and will continue to strive for excellence in regards to our service. We welcome any comments or ideas you may have. THANK YOU for your patronage.

I hereby authorize the repair work hereinafter set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection.

### DISCLAIMER OF WARRANTIES

It is understood and agreed by the undersigned purchaser that the product described hereon is sold by the dealer "AS IS", and that dealer makes no warranty of merchantability of the product and makes no warranty that such product is fit for any particular purpose and that any express written warranty relating to the product is a contract solely between the factory and the purchaser. The undersigned understands and agrees that there is no guarantee that the work done under this repair order will put the vehicle in good and proper working condition for the reason that the owner chose not to authorize other repairs necessary to place the vehicle in a safe condition and proper working order.

DOOR STICKER  
 COMPUTER

SUB TOTAL	19 95
TAX	1 00
<b>TOTAL</b>	<b>20 95</b>

### IMPORTANT: Safety Service Recommendations:

DATE BORN

CUSTOMER SIGNATURE

**50 MONTH**

**No 25264**

**SAAB MAINTENANCE FREE BATTERY**

**WARRANTY AND REGISTRATION CARD**  
(To be filled out by Saab Dealer at time of sale)

Owner's Name Michael Steffensen Battery No. 0271202 Selling Price 96.60

Address 2434 E River Rd New Fr

Date of Sale 5-3-93 VIN No. 433AT25L Selling Dlr. No. 1804  
3K2J20477

**LIMITED WARRANTY**

Saab-Scania of America, Inc., Saab Drive, Orange, Connecticut 06477, warrants to the original retail Customer purchaser only of a genuine Saab Maintenance-Free battery purchased from an authorized Saab dealer that when installed in a vehicle it will be free from defects in material and workmanship for a period of fifty (50) months commencing from the date of original installation, as long as it remains in the vehicle in which it was originally installed.

If any genuine Saab Maintenance-Free battery covered by this warranty is determined to be defective in material or workmanship and fails to hold a charge, any authorized Saab dealer will replace it during the first year of use, part only, with a new Saab battery of the same type upon its return and presentation of the warranty registration card. After one year the purchaser will be required to pay only a parts amount pro-rated at the rate of two percent (2%) of the current selling price for each month or part of a month following original installation. Labor costs are not covered in either case. THIS REMEDY IS THE SOLE AND EXCLUSIVE REMEDY AVAILABLE UNDER THIS WARRANTY AND ALL OTHER REMEDIES ARE HEREBY SPECIFICALLY EXCLUDED.

**THIS WARRANTY DOES NOT COVER:**

1. Failures resulting from misuse, commercial use, negligence, accident, damage or competition.
2. INCIDENTAL AND CONSEQUENTIAL DAMAGES TO THE EXTENT ALLOWED BY LAW (RESULTING FROM A DEFECT COVERED BY THIS WARRANTY OR BY ANY APPLICABLE IMPLIED WARRANTY) INCLUDING, BUT NOT LIMITED TO, LOSS OF USE OF THE VEHICLE, LOSS OF TIME, INCONVENIENCE AND COMMERCIAL LOSS.

THIS WARRANTY IS THE ONLY WARRANTY APPLICABLE TO GENUINE SAAB MAINTENANCE-FREE BATTERIES EXCEPT FOR ANY WARRANTIES OTHERWISE IMPLIED BY LAW. SUCH IMPLIED WARRANTIES ARE, HOWEVER, ALSO LIMITED TO THE DURATION OF THIS WRITTEN WARRANTY. NEITHER SAAB-SCANIA AB, SAAB-SCANIA OF AMERICA, INC. NOR FRANCHISED SAAB DEALERS, INDIVIDUALLY OR COLLECTIVELY, ASSUME OR AUTHORIZE ANYONE TO ASSUME FOR ANY OR ALL OF THEM OBLIGATION OR RESPONSIBILITY TO EITHER THE PURCHASER OF A GENUINE SAAB MAINTENANCE-FREE BATTERY OR TO ANY OTHER PERSON WITH RESPECT TO THE CONDITION OF SUCH BATTERY OTHER THAN AS EXPRESSLY ASSUMED IN THIS WARRANTY.

**Please Note:**

Some states do not allow limitations on how long an implied warranty lasts, and/or the exclusion or limitation of incidental or consequential damages, so the above limitations and exclusions may not apply to you. Moreover, this warranty gives you specific legal rights, and you may also have other rights which vary from state to state.

**SAVE THIS WARRANTY CARD AS PROOF OF PURCHASE**



# STRIETER MOTOR COMPANY

OUR 87TH YEAR  
520 W. Kimberly Road Telephone 391-1500  
DAVENPORT, IOWA 52806

VEHICLE INVOICE

9292

SOLD TO: Michael R. Steffenson  
ADDRESS: 2434 E. River Drive  
Davenport, Iowa 52803  
DATE: May 26, 1989  
SALESPERSON: Lowell S.

	YEAR	MAKE	NEW OR USED	STOCK NUMBER	MODEL OR SERIES	SERIAL NUMBER-VIN #	KEY NUMBER
VEHICLE SOLD	89	SAAB	N	S9417	900T Conv.	YS3AT75L3K7020477	
TRADE IN							

**INSURANCE COVERAGE INCLUDES**

- FIRE AND THEFT
- COLLISION-AMT. DEDUCT.
- PUBLIC LIABILITY-AMT.
- PROPERTY DAMAGE-AMT.

**OPTIONAL EQUIPMENT AND ACCESSORIES**

GROUP	DESCRIPTION
FACTORY INSTALLED:	
DEALER INSTALLED:	

I UNDERSTAND THAT LIABILITY INSURANCE COVERAGE WHICH WOULD PROTECT ME UNDER THE IOWA MOTOR VEHICLE FINANCIAL AND SAFETY RESPONSIBILITY ACT IS NOT INCLUDED IN MY PURCHASE OF THE HEREIN DESCRIBED MOTOR VEHICLE. I HAVE RECEIVED A COPY OF THIS STATEMENT.

SIGNATURE OF PURCHASER

SELLING PRICE	30,798.00
Adm Fees	15.00
TAX	1,232.52
LICENSE AND TITLE	37.00
<b>TOTAL CASH PRICE</b>	<b>32,082.52</b>
FINANCING INSURANCE	
<b>TOTAL TIME PRICE</b>	
<b>SETTLEMENT:</b>	
DEPOSIT	1,500.00
CASH ON DELIVERY	30,582.52
TRADE-IN \$ _____	
LESS LIEN \$ _____	
<b>PAYMENTS:</b>	
_____ AT \$ _____	
_____ AT \$ _____	
<b>TOTAL</b>	<b>32,082.52</b>

VIN	YR.	MODEL	COLOR	INVOICE DATE	KEY NO.	REG.	DIST.	DLR. CODE
Y53AT75L3K7020477	89	952M	CHERRY	05/22/89	AC1582	40	43	1804

VIN: K7020477 ORDER DATE: 04-17-89

**OWNER INFORMATION**

**PRIMARY OR COMPANY/LEASE DRIVER**

TITLE CODES	
1.	COMPANY CAR
2.	LEASE CAR
3.	MR.
4.	MRS.
5.	MS.
6.	MISS
7.	MR. & MRS.

TITLE CODE: 3  
 NAME: Steffenson, Michael R.  
 STREET: 2434 East River Drive  
 CITY: Davenport  
 STATE: Iowa  
 ZIP: 52803  
 BUS/HOME: H PHONE: (319) 359-7092

TITLE CODE:  
 NAME:  
 STREET:  
 CITY:  
 STATE:  
 ZIP:  
 BUS/HOME: PHONE:

**DEALERSHIP INFORMATION**

DEALER NAME: Strieter Motor Company  
 DELIVERY DATE: 05-27-89  
 SALES PERSON: Lowell Stuedemann  
 SALES MANAGER: Lowell Stuedemann

**WE'RE DEDICATED TO SAFETY**



**PLEASE BUCKLE UP!**

EXTENDED SERVICE CONTRACT	TRADE IN INFORMATION:	MAKE	MODEL	YEAR	MILEAGE
SAAB <input type="checkbox"/> OTHER <input type="checkbox"/>					

VIN	YR.	MODEL	COLOR	INVOICE DATE	KEY NO.	REG.	DIST.	DLR. CODE
Y53AT75L3K7020477	89	952M	CHERRY	05/22/89	AC1582	40	43	1804

**PRE-DELIVERY PROCEDURES COMPLETED**

All applicable inspections and services have been performed as outlined on the reverse side of this page and on the PDI checklist coupon in the Warranty/Service Record Booklet. Vehicle has been road tested and a final clean up and inspection performed. The car is fueled and ready for delivery.

*John Horden*  
SERVICE MANAGER

**PRESENTATION AND DEMONSTRATION OF NEW CAR FEATURES**

- Verify customer's receipt and review of Pre-Delivery Information Packet
- Operation of central locking system  Alarm system (if equipped)  Child proof locks-4 Dr.  Hood release
- Underhood-Location of engine oil dipstick, filler cap  Engine coolant, windshield/washer reservoir, brake fluid, transmission dipstick  Fuse box (extra fuses), bulb replacement  Underhood lamp (9000)
- Location of gas filler cap, emergency filler release (9000)  Trunk release  Spare, jack, handle (Indicate jack points)
- Tool Kit  Location of sunroof emergency crank (900 Turbo & SPG)  Trunk light switch
- Seat adjustments, fold down rear seats, seat belt operation/adjustment  Review airbag system (9000, if equipped)
- Review operation of ignition key, driving controls, instruments and warning lights  Explain use of Cruise Control  Fog light switch
- Information display (9000)  Heated seats  Climate control  Interior lights  Emergency sunroof crank (9000)  Fuse box (9000)
- Operation/removal of sound system  Accessories  Operation of convertible top
- TURBOCHARGED ENGINE: Warm up/cool down procedure  MANUAL TRANSMISSION: Shift up indicator & reverse gear engagement

**PRESENTATION AND EXPLANATION OF NEW CAR DOCUMENTS**

- Present Document Organizer. Review with owner appropriate manuals, warranties, and applicable accessory information. Insert emission performance warranty dealer certification statement, as well as sales representative and service manager's business card.
- Warranty/Service Record Booklet, check that PDI coupon has been removed and PDI record stub has been stamped in the service record section. Emphasize I.D. page, noting VIN, delivery date and new car warranty expiration.
- Importance of recommended maintenance schedules and proper use of service record. Emphasize break-in service (free except fluids and oil filter if performed between 800 - 1500 miles).
- Terms of applicable warranties: new car, emission controls, tires (manufacturer's warranty), perforation and parts/accessories.
- Thoroughly explain and offer Saab Extended Service Contract.

**INTRODUCTION OF RESPONSIBLE DEALER PERSONNEL**

SERVICE MANAGER  PARTS MANAGER  DEALER PRINCIPAL/GENERAL MANAGER

The owner of this new Saab has been briefed on the items listed above and advised of our service department business hours and whom to contact for an appointment for maintenance and service requirements.

*Lowell Stuedemann*  
DEALER SALES REPRESENTATIVE

*Michael [Signature]*  
CUSTOMER

I have received my new Saab in accordance with the dealer's Dedicated Delivery.

MOTOR VEHICLE PURCHASE AGREEMENT

No. \_\_\_\_\_

DATE 05-26-89

(DEALER) **STRIETER MOTOR COMPANY**  
 (STREET) **520 West Kimberly Road - (319) 391-1500**  
 (CITY) **Davenport, Iowa 52806**  
**LOWELL S** (SALESMAN)

**MICHAEL R STEFFENSON** BUYER'S NAME  
**2434 EAST RIVER DRIVE** STREET ADDRESS  
**DAVENPORT IA SCOTT** CITY STATE COUNTY  
**52803** ZIP CODE  
 RES. PHONE **319-359-7092** US. PHONE **309-762-7716**

PLEASE ENTER MY ORDER FOR THE FOLLOWING

NEW  USED  TRUCK  CAR  
 YEAR 89 MAKE SAAB  
 COLOR RED UPPER LOWER TRIM ALMOND

SERIES 900T CONVT BODY TYPE 2DR STOCK NO S9417 V.I.N # YS3AT75L3K7020477  
 TO BE DELIVERED ON OR ABOUT 05-26 19 89

CASH PRICE OF VEHICLE	\$	
FREIGHT		
ACCESSORIES		
<b>VEHICLE + ACCESSORIES</b>		<b>32454.00</b>
DEALER OPTION 1 Compact Disc Player	725.00	
DEALER OPTION 2 Gauge Package	311.00	
DEALER OPTION 3 Push Floor Mats	103.00	
DEALER OPTION 4 Mahogany Shift Knob	31.00	
LESS DISCOUNT		3000.00

USED VEHICLE TRADE-IN AND/OR OTHER CREDITS	
MAKE OF USED VEHICLE	
YEAR	BODY TYPE
SERIES	PLATE NO.
V.I.N. #	<u>NA</u>
BALANCE OWED TO	
ADDRESS	
USED VEHICLE ALLOWANCE *	\$
LESS BALANCE OWED	N/A
NET ALLOWANCE ON USED VEHICLE	\$
DEPOSIT OR CREDIT BALANCE	1500.00
CASH WITH ORDER	N/A
TOTAL DOWN PAYMENT (TRANSFER TO LEFT COLUMN)	\$ 1500.00

**BUYER'S CERTIFICATION**

I hereby certify that:

(1) The face and reverse sides of this order set forth all of the terms and conditions of the order; there are no other contracts or provisions, oral or written, supplementary or in addition to the provisions expressly set forth in this order; other than the window form on this vehicle as provided in paragraph 2B on the reverse side of this order if this is the sale of a used vehicle; this order cancels and supersedes all other understandings and agreements of the parties prior to the signing hereof and as of the date hereof, when signed by the dealer, comprises the complete and exclusive agreements of the parties, AND

(2) The only existing material defects known to me on the motor vehicle that is being traded in to dealer are: None - AND (if none, so state)

(3) I have read the terms and conditions of this order and have received a true copy thereof; AND

(4) THIS AGREEMENT IS NOT BINDING UNTIL ACCEPTED BY THE SELLING DEALER OR HIS AUTHORIZED REPRESENTATIVE; AND

(5) I understand that liability insurance coverage which would protect me under the Iowa Motor Vehicle Financial and Safety Responsibility Act is NOT INCLUDED in my purchase of the herein described motor vehicle. I have received a true copy of this statement.

X [Signature] (Buyer's Signature)  
 X \_\_\_\_\_ (Co-Buyer's Signature)  
479 36 7152 Soc. Sec. or Emp. No. (Buyer) Soc. Sec. or Emp. No. (Co-Buyer)  
 ACCEPTED BY: \_\_\_\_\_ (Dealer or his authorized representative)


**DISCLAIMER OF WARRANTY**

It is understood and agreed by the buyer that the vehicle above described is sold by the dealer "AS IS" with ALL FAULTS and that dealer makes no warranty of merchantability of the vehicle and makes no warranty that such vehicle is fit for any particular purpose. (SEE REVERSE SIDE FOR FACTORY WARRANTY INFORMATION).

BIRTH MONTH	<u>05</u>
ADMINISTRATIVE FEE	<u>155.00</u>
TOTAL SALES PRICE	\$ <u>30813.00</u>
LESS TRADE-IN ALLOWANCE *	N/A
TRADE DIFFERENCE (TAX PRICE)	\$ <u>30813.00</u>
TAX \$	<u>1232.52</u>
TITLE FEE \$	<u>10.00</u>
LICENSE FEE \$	<u>27.00</u>
LOCAL OPT TAX	\$ <u>N/A</u>
TOTAL CASH DELIVERED PRICE	\$ <u>32082.52</u>
LESS TOTAL DOWN PAYMENT (TRANSFERRED FROM RIGHT COLUMN)	\$ <u>1500.00</u>
UNPAID CASH BALANCE DUE ON DELIVERY	\$ <u>30582.52</u>

# SAAB


## 900—INSTALLATION INSTRUCTIONS (Equipped with passive restraints)

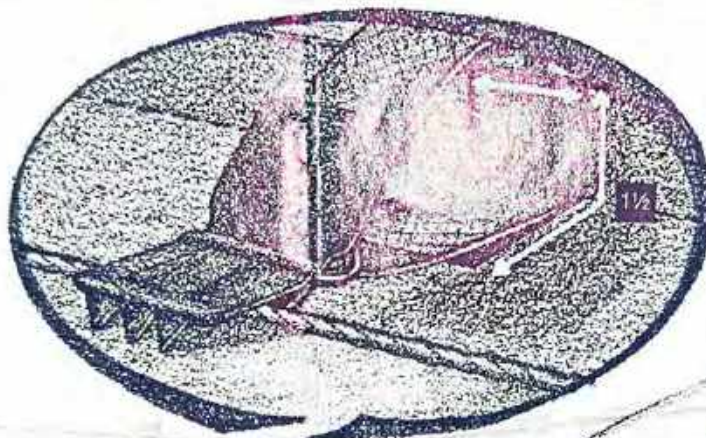

1. Using a razor blade or a sharp knife, make two  $\frac{1}{2}$ " x  $1\frac{1}{2}$ " long strips from the rear carpet where the floor pan meets the driver's seat support beam in the positions marked with an "x" in the illustration below. Be careful not to cut any wires.

2. Pass the Mat-Loc® strap end through the openings in the carpet, around the beam, and through the buckle. Tighten securely.

3. Open the Mat-Loc clip and attach to the rear edge of the floor mat. Close clip tightly.

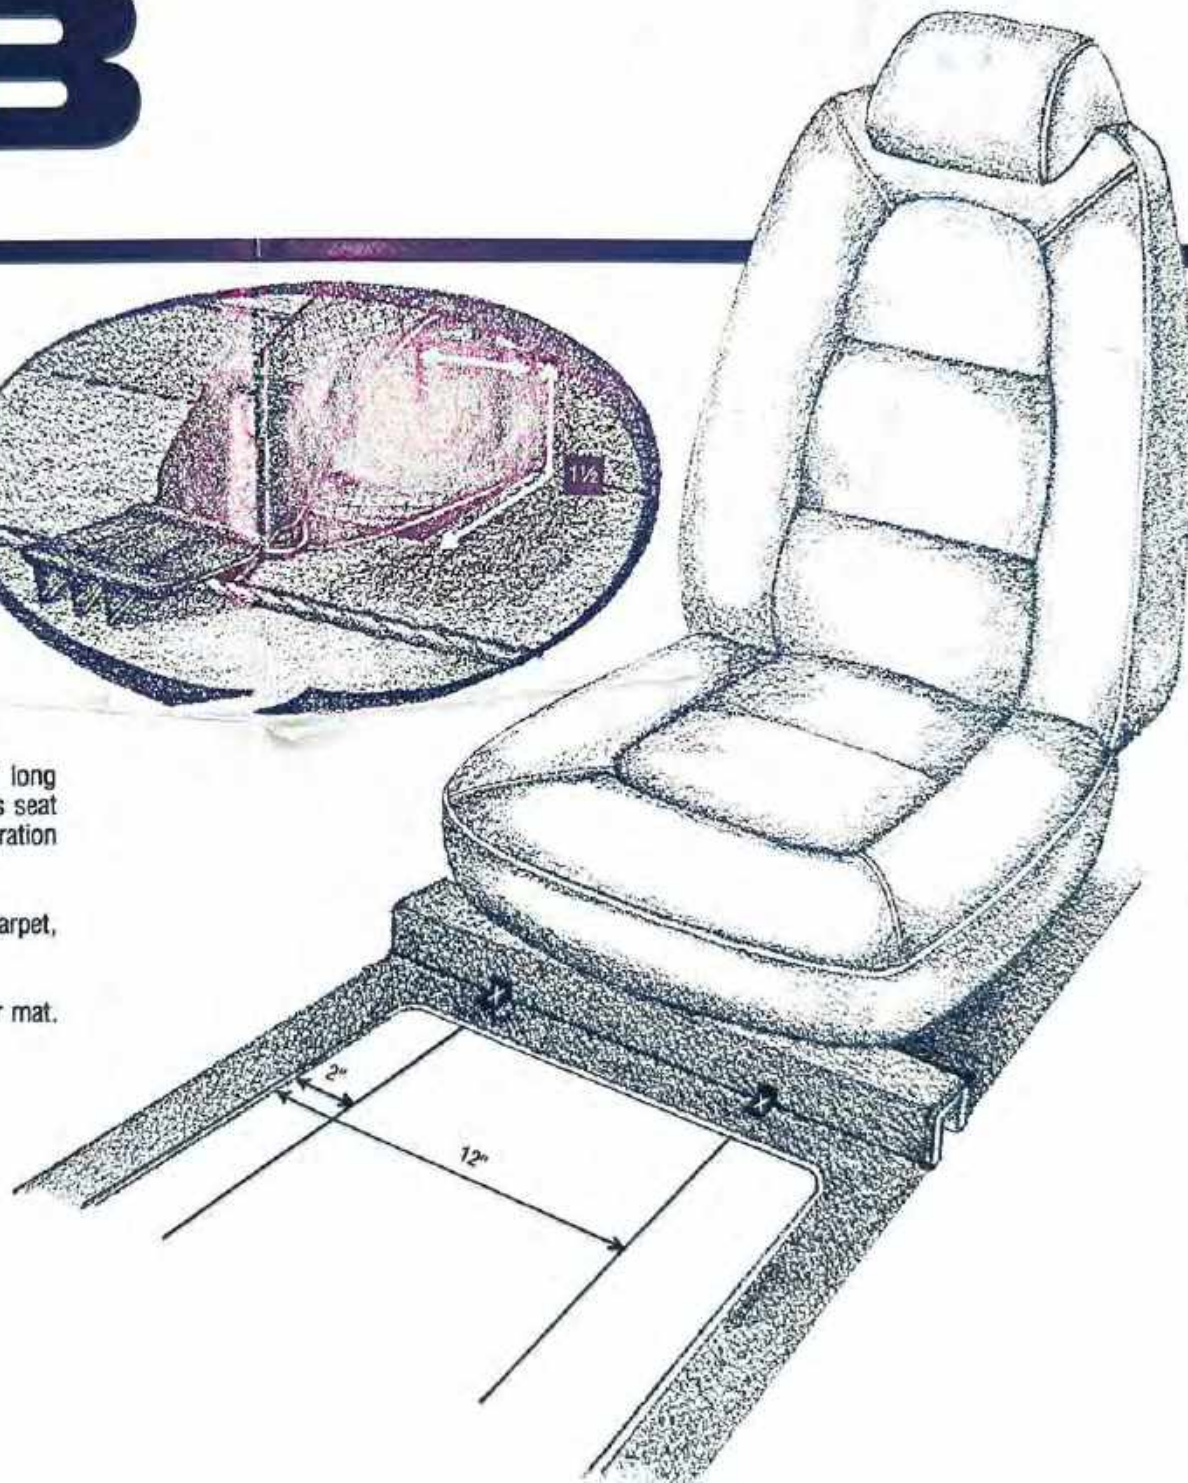



**SAAB**

Saab-Scania of America, Inc.

Authorized Dealer  
**STRIETER MOTOR CO.**  
 520 WEST KIMBERLY ROAD  
 DAVENPORT, IOWA 52806

Make & Model  
 1989 SAAB 900 TURBO CONV/952M

Color  
 CHERRY RED LO. 542854

Vehicle ID No.  
 YS3A175L3K7020477

Port Of Importation  
 BRUN, GA KYUSHU MARU


Delivered By  
 TRUCK

<b>Standard Equipment</b> 4 CYL 16 VALVE DOHC TURBO ENGINE APC CHARGE PRESSURE CONTROL SYSTEM CHARGE AIR INTERCOOLER ELECTRONIC FUEL INJECTION SYSTEM ELECTRONIC IGNITION, HALL EFFECT RACK/PINION POWER ASSIST STEERING 4 WHEEL POWER ASSIST DISC BRAKES TINTED GLASS, ALL AROUND ELECTRIC REAR WINDOW DEMISTER UNDERCOAT/ANTI-CORROSION TREATMENT UPPER BODY SIDE MOLDING DUAL POWER MIRRORS, HEATED 185/65 H-RATED STEEL BELT RADIALS GAS/HYDRAULIC SHOCK ABSORBERS FRONT/REAR STABILIZER BARS LIGHT ALLOY WHEELS POWER TOP WITH FULL HEADLINER ELECTRIC WINDOWS, FRONT/REAR TIME DELAY COURTESY LIGHTS FRONT/REAR SPOILERS	5 SPEED MANUAL TRANSMISSION HALOGEN REPLACEABLE BULB HEADLAMPS LIGHTS, CORNERING/SIDE REVERSING FRONT FOG LIGHTS TACHOMETER/QUARTZ ANALOG CLOCK DRIVER SEAT HEIGHT/TILT ADJUST RECLINING, HEATED FRONT SEATS REAR SEAT HEADRESTS LEATHER SEATING SURFACES LEATHER WRAPPED STEERING WHEEL CENTRAL LOCK SYSTEM, DOORS/TRUNK AIR CONDITIONING ELECTRONIC CRUISE CONTROL TIME DELAY COURTESY LIGHTS CENTER CONSOLE, FRONT THEFT ALARM 80W ELECTRONIC AM/FM STEREO/CASS 7 BAND EQUALIZER 4 SPEAKER SOUND SYSTEM AUTOMATIC ELECTRIC ANTENNA
--	--

<b>Importer's Suggested Port-of-Entry Price:</b>	<b>32,095.00</b>
Options and Additional Charges	
DESTINATION CHARGE	359.00
DEALER PREPARATION (PRE-DELIVERY INSPECTION SERVICE)	INCL IN PRICE
3 YEAR/36,000 MILE LIMITED VEHICLE WARRANTY	INCL IN PRICE
6 YEAR PERFORATION WARRANTY	INCL IN PRICE
<b>Total Suggested Retail Price</b>	<b>32,454.00</b>


The above information is affixed pursuant to Federal Automobile Information Disclosure Act. Importer's suggested retail price does not include gasoline, license and title fees and state and local taxes. Dealer installed options and accessories are not included. Where transportation charge is not shown, this has been paid by dealer directly to transporter.  
 Saab-Scania of America, Inc. is the sole factory authorized importer of this vehicle and is a subsidiary of the manufacturer-Saab Car Division, Nykoping Sweden

**Compare this vehicle to others in the FREE GAS MILEAGE GUIDE available at the dealer**

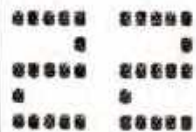**CITY MPG**

1989 SAAB 900, 2.0L ENGINE, 16-VALVE 4-CYLINDER, TURBOCHARGER, 3-WAY CATALYST, FEEDBACK FUEL SYSTEM, 5-SPEED MANUAL TRANSMISSION

**Estimated Annual Fuel Cost:**  
\$594

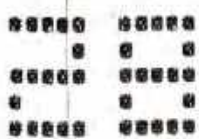
**HIGHWAY MPG**

For Comparison Shopping, all vehicles classified as **SUBCOMPACT** have been issued mileage ratings ranging from

11 to 18 mpg city and 10 to 15 mpg highway

**We are Dedicated to Your Safety**

# Seat Belts Save Lives...

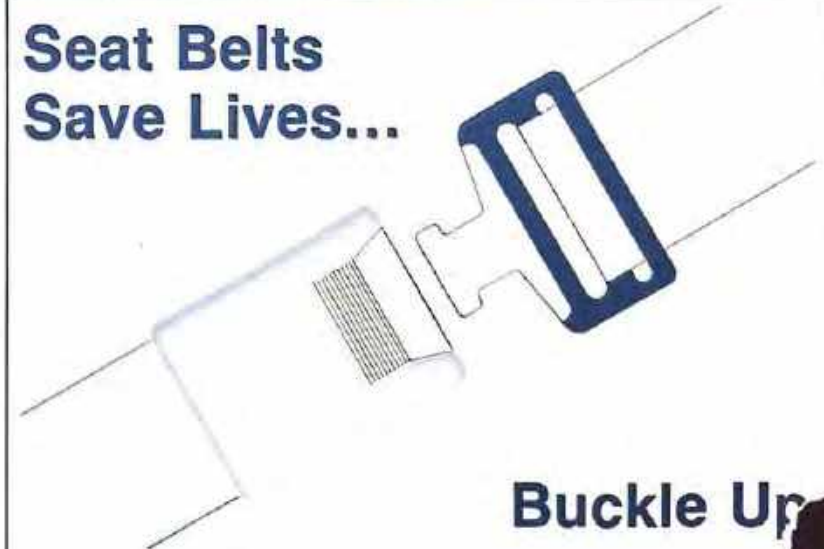

## Buckle Up

**Invoice No.**  
**000035332**

**Page 1**  
**Order Date 04/09/22 11:31 am**  
**Completed: 04/12/22 05:46 pm**

**ForeignAffairsMN.com**  
**8790 Excelsior Blvd.**  
**Hopkins, MN 55343**  
**Phone: 952-939-9282 FAX: 952-935-8268**

**86 Alfa Romeo GTV-6 red**  
**50600 Mi.Last in 7/31/2021**  
**Lic: OMO398/ON 6Cyl 2.5 Eng**  
**Vin: ZARRAA669XG1008014 01/86**  
**Eq:**

**Job01 Spring service**

**Labor: \$135.00**

**Battery dead. Pick up at customer's storage. Jump start and run to shop. Charge battery on smart charger overnite. Check fluids and tire pressures. All OK. Wash and vacuum.**

**Job Subtotal: \$135.00**

**Recommendations: \*Lube, Oil and Filter\***

**Payments to Foreign Affairs**

**Status: Completed Work Order**

**Payments:**

**Cost Summary**

<b>Labor</b>	<b>135.00</b>
<b>Parts</b>	<b>0.00</b>
<b>Enviromental</b>	<b>2.70</b>
<b>Shop Supplies</b>	<b>8.10</b>
<b>Tax</b>	<b>0.61</b>
<b>Total</b>	<b>\$146.41</b>
<b>Payments</b>	<b>0.00</b>
<b>Bal Due</b>	<b>146.41</b>

**Thank you for choosing Foreign Affairs**